

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

6.3

1.8

N/A

8.0

Yes

No

No

N/A

No

N/A

1.4

0.2

N/A

N/A

N/A

N/A

N/A

N/A

Yes

N/A

No

N/A

Good

Intersection ID: 17882 Main Street: CHELSEA DR **Cross Street: WALES AV** Location: NE Initial Pass/Fail: Pass **Overall Compliance: No** 10 ADA ID: 817901E930E0 Ramp Type: Perp **Severity Score:**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Yes

Yes

N/A

Yes

N/A

No

N/A

N/A

N/A

N/A

Yes

Yes

N/A

N/A

N/A

N/A

Yes

Yes

Compliance Description

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space to XWalk (in)

Storm Grate/Utility Hazard?

Storm Grate/Utility Type

Surface Condition? (G/P)

Clear Space?

Flare Traversable RT?

Data

105.0

53.0

0.4

Yes

53.5

48.0

2.8

0.7

No

Yes

No

0.0

No

To S

N/A

1.2

0.3

N/A

N/A

N/A

No

N/A

Sloped

X Walk 1 X Slope (%)

Ramp inside XWalk1?


Road Slope (%)

Road X Slope (%)

Any Obstructions?

Obstruction Type

Flare Traversable LT?

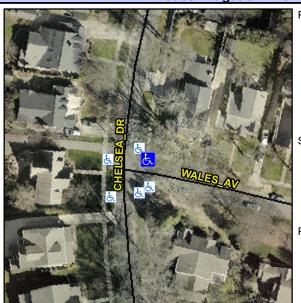

WALES AV Street 1 Name Stop Condition-Street 2 StopSign N/A Street 2 Name Stop Condition-Street 1 N/A

Possible Solutions:	Compli	ance Description
Remove & Replace Entire Ramp.	N/A	Ramp Length (in)
·	Yes	Ramp Width (in)
	N/A	Flare Type LT
	N/A	Flare Slope LT (%)
	N/A	Flare Traversable L
	Yes	Landing Length (in)
Surveyor Notes:	Yes	Landing Width (in)
N/A	No	Landing Slope (%)
	Yes	Landing X Slope (%
	N/A	Landing Curb? (Y/N
	N/A	Shared Landing?
PROW/ADA:	Yes	Gutter Ponding?
R304.2.2-Perp, R304.3.2-Para, R305	Yes	Gutter Lip Ht (in)
• •	N/A	Painted X Walk1?
		X Walk 1 Direction
	N/A	X Walk 1 Width (in)
		X Walk 1 Slope (%)
		X Walk 1 X Slope (%
	N/A	Ramp inside XWalk

Total Cost:







Yes

1850.00