

## Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 47016 Main Street: TRIBUNE\_DR Cross Street: GLAZER\_VALLEY\_CT Location: N

ADA ID: 81832958FADD Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 28.75

## **Codes/Mitigation Info/Possible Solution**

## Field Measurements/Component Compliance

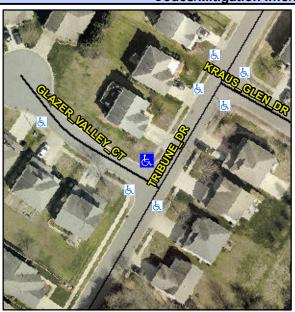

Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

GLAZER VALLEY CT StopSign TRIBUNE DR None Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2, R304.5.3, R302.7

Total Cost: \$ 3200.00

Compliance Description Data Compliance Description Data 45.5 No N/A Ramp Length (in) Ramp Slope (%) 9.1 No Ramp XSlope (%) Yes Ramp Width (in) 48.0 3.1 N/A N/A Flare Type LT N/A Flare Type RT N/A N/A N/A N/A Flare Slope RT (%) N/A Flare Slope LT (%) N/A Flare Traversable LT? N/A N/A Flare Traversable RT? N/A N/A Landing Length (in) N/A N/A DWS Provided? N/A N/A Landing Width (in) N/A N/A **DWS Contrast?** N/A N/A N/A N/A Landing Slope (%) DWS Length (in) N/A N/A Landing X Slope (%) N/A N/A DWS Full Width? N/A N/A Landing Curb? (Y/N) N/A N/A DWS Offset (in) N/A N/A N/A Shared Landing? N/A **Gutter Ponding?** N/A N/A Gutter Slope (%) N/A N/A Gutter Lip Ht (in) N/A N/A Gutter X Slope (%) N/A N/A Painted X Walk1? No N/A Painted X Walk2? No X Walk 1 Direction To SW X Walk 2 Direction To SE N/A N/A X Walk 1 Width (in) X Walk 2 Width (in) N/A X Walk 1 Slope (%) 5.8 X Walk 2 Slope (%) 0.9 X Walk 1 X Slope (%) 1.1 X Walk 2 X Slope (%) 5.9 N/A N/A N/A Ramp inside XWalk2? N/A Ramp inside XWalk1? Road Slope (%) 2.8 N/A Clear Space? N/A N/A Road X Slope (%) 6.9 Clear Space to XWalk (in) N/A N/A N/A N/A Any Obstructions? Storm Grate/Utility Hazard? N/A **Obstruction Type** Storm Grate/Utility Type N/A N/A

No

Surface Condition? (G/P)

Poor





