


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12728	Main Street: E_10TH_ST	Cross Street: SEIGLE_AV	Location: N
ADA ID: 81A7CD5171AA	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 7.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

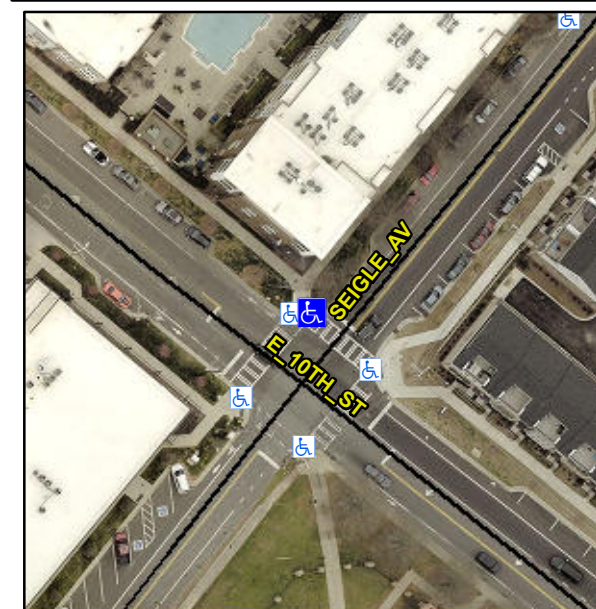

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R305.2, R302.7.2

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	77.0	Yes	BlendTrans Slope (%)	2.9
Yes	Ramp Width (in)	70.5	No	BlendTrans XSlope (%)	3.6
Yes	Flare Type LCurbed_NoWalkSurface	Yes	Yes	Flare Type RCurbed_NoWalkSurface	Yes
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	53.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.8	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	7.0
N/A	Shared Landing?	Yes			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.1
No	Gutter Lip Ht (in)	0.3	No	Gutter X Slope (%)	4.2
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	110.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.6		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.6		Clear Space?	Yes
	Road X Slope (%)	4.1	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	10.3

Street 1 Name	SEIGLE ST
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

