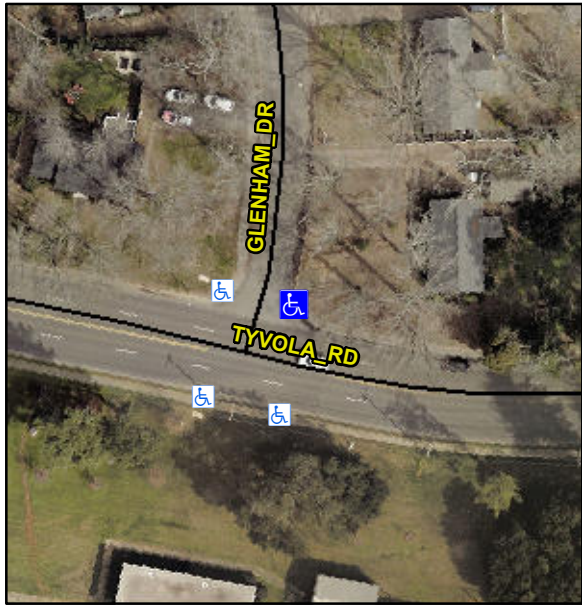


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 18932	Main Street: GLENHAM_DR	Cross Street: TYVOLA_RD	Location: NE
ADA ID: 81B3CABCB2A5	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance							
	Possible Solutions:			<b>Compliance</b>	<b>Description</b>	<b>Data</b>	<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>			N/A	Ramp Length (in)	53.0	No	Ramp Slope (%)	10.0
				Yes	Ramp Width (in)	100.0	Yes	Ramp XSlope (%)	1.8
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
<p>Surveyor Notes:</p> <p>N/A</p>	PROW/ADA:			N/A	Shared Landing?	N/A			
				N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
				N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
				N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
					X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
				N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
					X Walk 1 Slope (%)	4.5		X Walk 2 Slope (%)	2.6
					X Walk 1 X Slope (%)	3.4		X Walk 2 X Slope (%)	2.4
				N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
					Road Slope (%)	1.4	N/A	Clear Space?	N/A
<p>Total Cost:</p> <p>\$ 3200.00</p>					Road X Slope (%)	5.7	N/A	Clear Space to XWalk (in)	N/A
				N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
					Obstruction Type			Storm Grate/Utility Type	
						N/A			N/A
							Yes	Surface Condition? (G/P)	Good

