


Intersection ID: 47983	Main Street: SPRINGS_MILL_RD	Cross Street: WHEAT_RIDGE_RD	Location:	NE
ADA ID: 81BA00A5BDCC	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 5.25

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

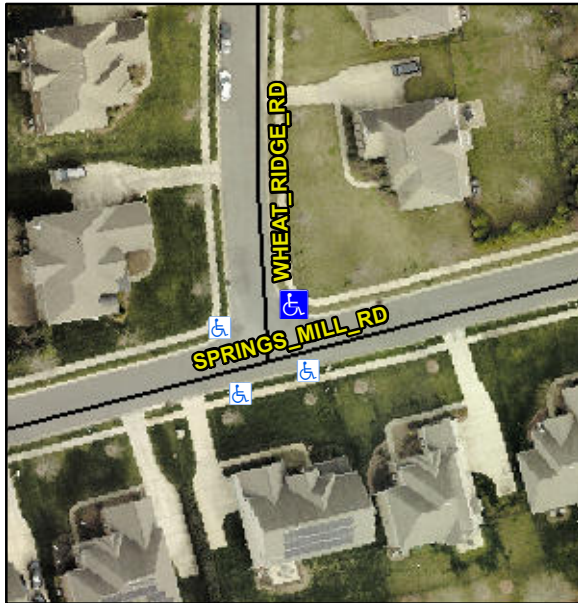

### Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.3, R304.2.2-Perp,  
R304.3.2-Para, R305.2, R304.5.4**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	51.0	Yes	Ramp Slope (%)	5.6
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	1.3	N/A	Flare Slope RT (%)	7.0
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.1	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.6	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	5.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.9
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	1.8
	X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	1.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.4	N/A	Clear Space?	Yes
	Road X Slope (%)	0.9	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

**Total Cost: \$ 3950.00**

Street 1 Name	WHEAT RIDGE RD
Stop Condition-Street 2	StopSign
Street 2 Name	SPRINGS MILL RD
Stop Condition-Street 1	None

