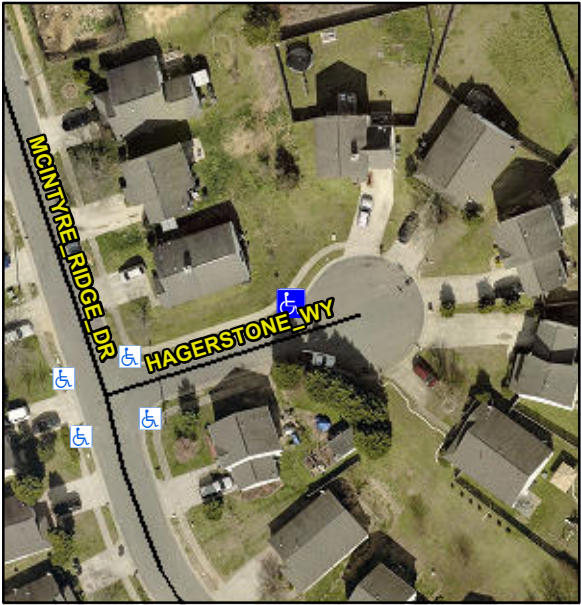



Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10027809	Main Street: HAGERSTONE_WY	Cross Street: N/A	Location: NE
ADA ID: 81C0D5683DEE	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 33.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	45.0
			Yes	Ramp Width LT (in)	49.0
			No	Ramp Slope LT (%)	9.6
			Yes	Ramp XSlope LT (%)	1.7
			N/A	Ramp Length (in)	44.5
			No	Ramp Width (in)	45.5
	Surveyor Notes:		N/A	Flare Type LT	N/A
	N/A		N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
	PROW/ADA:		N/A	Landing Length (in)	N/A
	R304.5.1, R304.5.3, R304.3.2		N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To S
				X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	6.1
				X Walk 1 X Slope (%)	5.3
	Total Cost:	\$ 1800.00	N/A	Ramp inside XWalk1?	N/A
				Road Slope (%)	5.3
				Road X Slope (%)	6.1
			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
				Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
					N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	N/A