

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10015635	Main Street: HARRIS_CORNERS_PY	Cross Street: N/A	Location: S
ADA ID: 8203A1C7973E	Ramp Type: BlendTrans2	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 10	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

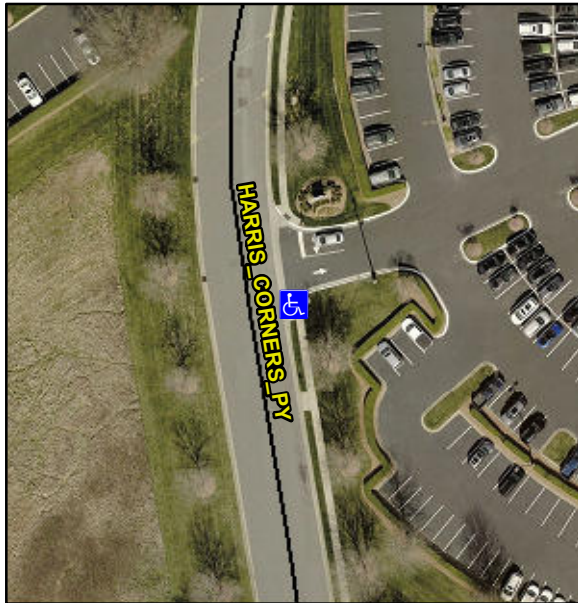

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.1, R304.5.3**

Street 1 Name	<b>HARRIS CORNERS PY</b>
Stop Condition-Street 1	<b>None</b>
Street 2 Name	<b>N/A</b>
Stop Condition-Street 2	<b>StopSign</b>

Total Cost: \$ **3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	<b>60.0</b>	Yes	BlendTrans Slope (%)	<b>3.5</b>
No	Ramp Width (in)	<b>42.0</b>	No	BlendTrans XSlope (%)	<b>2.4</b>
N/A	Flare Type LT	<b>N/A</b>	N/A	Flare Type RT	<b>N/A</b>
N/A	Flare Slope LT (%)	<b>N/A</b>	N/A	Flare Slope RT (%)	<b>N/A</b>
N/A	Flare Traversable LT?	<b>N/A</b>	N/A	Flare Traversable RT?	<b>N/A</b>
N/A	Landing Length (in)	<b>N/A</b>	N/A	DWS Provided?	<b>N/A</b>
N/A	Landing Width (in)	<b>N/A</b>	N/A	DWS Contrast?	<b>N/A</b>
N/A	Landing Slope (%)	<b>N/A</b>	N/A	DWS Length (in)	<b>N/A</b>
N/A	Landing X Slope (%)	<b>N/A</b>	N/A	DWS Full Width?	<b>N/A</b>
N/A	Landing Curb? (Y/N)	<b>N/A</b>	N/A	DWS Offset (in)	<b>N/A</b>
N/A	Shared Landing?	<b>N/A</b>			
N/A	Gutter Ponding?	<b>N/A</b>	N/A	Gutter Slope (%)	<b>N/A</b>
N/A	Gutter Lip Ht (in)	<b>N/A</b>	N/A	Gutter X Slope (%)	<b>N/A</b>
N/A	Painted X Walk1?	<b>No</b>	N/A	Painted X Walk2?	<b>No</b>
	X Walk 1 Direction	<b>To W</b>		X Walk 2 Direction	<b>To N</b>
	X Walk 1 Width (in)	<b>N/A</b>		X Walk 2 Width (in)	<b>N/A</b>
	X Walk 1 Slope (%)	<b>3.9</b>		X Walk 2 Slope (%)	<b>2.4</b>
	X Walk 1 X Slope (%)	<b>1.3</b>		X Walk 2 X Slope (%)	<b>2.4</b>
N/A	Ramp inside XWalk1?	<b>N/A</b>	N/A	Ramp inside XWalk2?	<b>N/A</b>
	Road Slope (%)	<b>2.0</b>		Clear Space?	<b>N/A</b>
	Road X Slope (%)	<b>0.8</b>	N/A	Clear Space to XWalk (in)	<b>N/A</b>
N/A	Any Obstructions?	<b>N/A</b>	N/A	Storm Grate/Utility Hazard?	<b>N/A</b>
	Obstruction Type			Storm Grate/Utility Type	
		<b>N/A</b>			<b>N/A</b>
			Yes	Surface Condition? (G/P)	<b>Good</b>
			N/A	Curb Slope (%)	<b>1.0</b>

