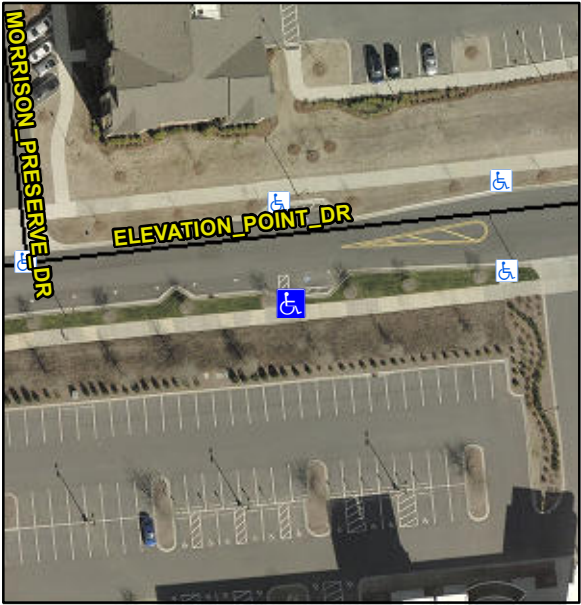


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10025871	Main Street: ELEVATION_POINT_DR	Cross Street: N/A	Location: S
ADA ID: 821C8546F251	Ramp Type: Combination2	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	91.5
			Yes	Ramp Width LT (in)	93.5
			No	Ramp Slope LT (%)	8.9
			Yes	Ramp XSlope LT (%)	0.5
			N/A	Ramp Length (in)	36.5
			Yes	Ramp Width (in)	60.0
	Surveyor Notes:		N/A	Flare Type LT	N/A
	N/A		N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
	PROW/ADA:		N/A	Landing Slope (%)	N/A
	Not Found, R304.5.3, R304.3.2		N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To N
				X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	0.2
				X Walk 1 X Slope (%)	1.9
	Total Cost:	\$ 1600.00	N/A	Ramp inside XWalk1?	N/A
				Road Slope (%)	N/A
				Road X Slope (%)	N/A
				Clear Space?	N/A
				Clear Space to XWalk (in)	N/A
				Any Obstruction?	N/A
				Obstruction Type	N/A
				Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
				Surface Condition? (G/P)	Good
				Curb Slope (%)	13.6

Street 1 Name	None
Stop Condition-Street 1	ELEVATION POINT DR
Street 2 Name	N/A
Stop Condition-Street 2	N/A

