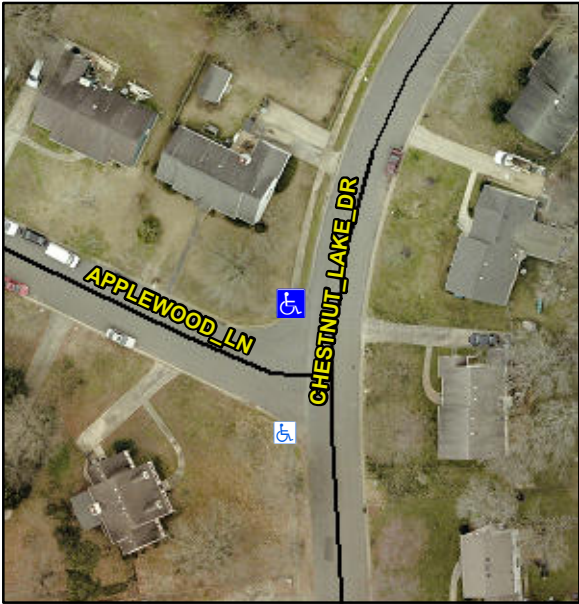


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 16121	Main Street: APPLEWOOD_LN	Cross Street: CHESTNUT_LAKE_DR	Location: NW
ADA ID: 8252CEDCBA09	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 33.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
 <p>Street 1 Name APPLEWOOD LN</p> <p>Stop Condition-Street 1 StopSign</p> <p>Street 2 Name N/A</p> <p>Stop Condition-Street 2 N/A</p>	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	62.0	N/A	Grade Break?	N/A
			No	Ramp Width (in)	46.5	N/A	Grade Break Slope (%)	0.0
			Yes	Ramp Slope (%)	6.3	N/A	Grade Break XSlope (%)	0.0
			No	Ramp XSlope (%)	11.0			
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
	Surveyor Notes:		N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
				Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
			Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A	
			Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A	
PROW/ADA:			Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A	
R304.5.1, R304.5.3			Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A	
			Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A	
			Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A	
			Painted X Walk1?	No		Road Slope (%)	2.7	
			X Walk 1 Direction	To S		Road X Slope (%)	3.2	
			X Walk 1 Width (in)	N/A		Clear Space?	N/A	
			X Walk 1 Slope (%)	2.7	N/A	Clear Space to XWalk (in)	N/A	
			X Walk 1 X Slope (%)	3.2	N/A	Storm Grate/Utility Hazard?	N/A	
			Ramp inside XWalk1?	N/A		Storm Grate/Utility Type		
			Any Obstructions?	N/A			N/A	
			Obstruction Type		Yes	Surface Condition? (G/P)	Good	
					N/A	Curb Slope (%)	20.5	
Total Cost:		\$ 1600.00						

