


## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Intersection ID: 19953 Main Street: ARCHDALE\_DR Cross Street: OLD\_PINEVILLE\_RD Location: SE Severity Score: **Overall Compliance: No** ADA ID: 82C3561A1C6A Ramp Type: Perp Initial Pass/Fail: Fail 22.5

**Codes/Mitigation Info/Possible Solution** 

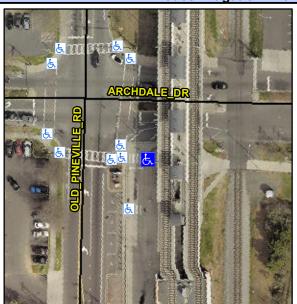

The second secon	THE RESERVE TO SHARE THE PARTY OF THE PARTY
Street 1 Name	OLD PINEVILLE RD
Stop Condition-Street 2	Signal
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Sec. 1	Possible Solutions:
1	Remove & Replace Entire Ramp.
e e	
1	
100	Surveyor Notes:
100	N/A
-	
-	
6	
3	PROW/ADA:
	Not Found, R304.5.1, R304.2.2,
No. of Street, or other Persons and the Person	R304.5.3
1	

Total Cost:	\$ 1850.00

Field Measurements/Component Compliance								
Comp	Compliance Description		Compliance Description		Data			
N/A	Ramp Length (in)	73.0	No	Ramp Slope (%)	8.8			
No	Ramp Width (in)	45.0	No	Ramp XSlope (%)	2.5			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A			
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A			
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A			
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A			
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A			
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A			
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A			
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A			
N/A	Shared Landing?	N/A						
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A			
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A			
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A			
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A			
N/A	X Walk 1 Width (in)	120.0	N/A	X Walk 2 Width (in)	N/A			
	X Walk 1 Slope (%)	2.8		X Walk 2 Slope (%)	N/A			
	X Walk 1 X Slope (%)	1.8		X Walk 2 X Slope (%)	N/A			
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A			
	Road Slope (%)	N/A	N/A	Clear Space?	N/A			
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A			
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A			
	Obstruction Type			Storm Grate/Utility Type				
		N/A			N/A			
			Yes	Surface Condition? (G/P)	Good			





