


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 3104	Main Street: DUVALL_MEADOW_LN	Cross Street: LOMAX_RIDGE_DR	Location: S
ADA ID: 82D21ECCE390	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 2.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

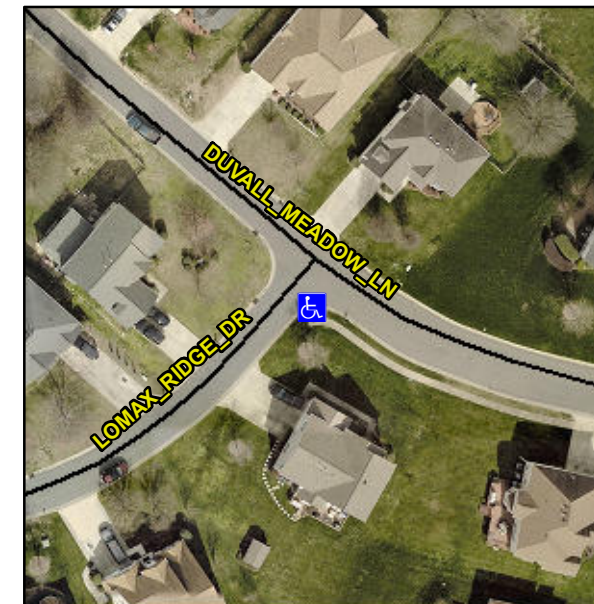

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.1.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.5	Yes	BlendTrans Slope (%)	3.4
Yes	Ramp Width (in)	48.0	No	BlendTrans XSlope (%)	3.1
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	0.7	N/A	Flare Slope RT (%)	5.0
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	47.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	52.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.1	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	4.4	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.0
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.8		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.8		Clear Space?	Yes
	Road X Slope (%)	4.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	4.7

Street 1 Name DUVALL MEADOW LN
 Stop Condition-Street 1 None
 Street 2 Name LOMAX RIDGE DR
 Stop Condition-Street 2 StopSign

