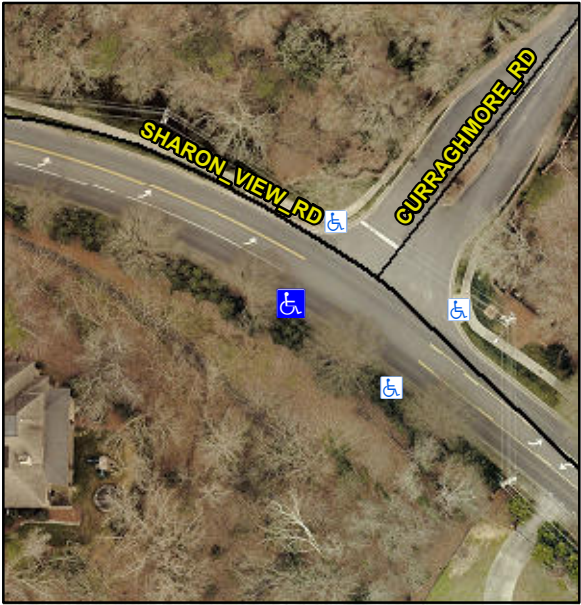


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 20968	Main Street: CURRAGHMORE_RD	Cross Street: SHARON_VIEW_RD	Location: SW
ADA ID: 8324CDD2A006	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	69.0
			Yes	Ramp Width LT (in)	55.0
			No	Ramp Slope LT (%)	8.8
			No	Ramp XSlope LT (%)	2.2
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.3.2, R304.5.3</p>			N/A	Ramp Length RT (in)	70.0
			Yes	Ramp Width RT (in)	55.0
			Yes	Ramp Slope RT (%)	6.5
			No	Ramp XSlope RT (%)	3.0
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Slope (%)	N/A
			N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To NE
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	3.3
				X Walk 1 X Slope (%)	0.5
			N/A	Ramp inside XWalk1?	N/A
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	5.4
Total Cost:		\$ 1600.00			

