


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 11231	Main Street: W_4TH_ST_EXT	Cross Street: WALNUT_AV	Location:	N
ADA ID: 833FDF6C6DD4	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

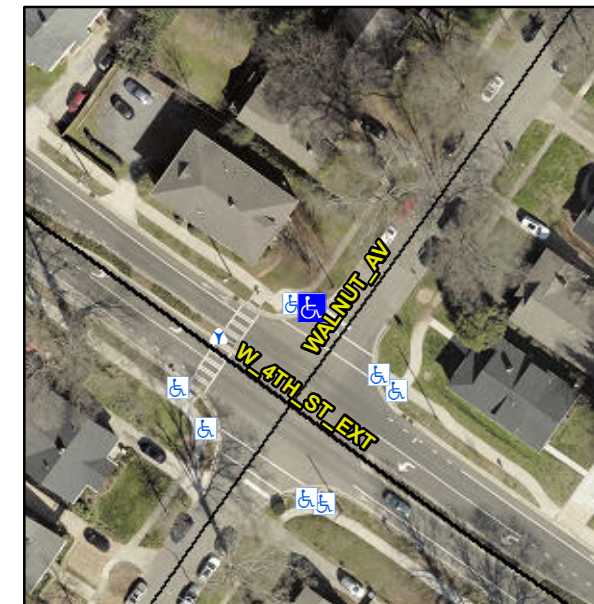

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.2, R305.2

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	65.0	No	Grade Break?	No
Yes	Ramp Width (in)	70.5	N/A	Grade Break Slope (%)	N/A
Yes	Ramp Slope (%)	7.3	N/A	Grade Break XSlope (%)	N/A
Yes	Ramp XSlope (%)	1.3			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	45.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	70.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.4	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset LT (in)	N/A
N/A	Shared Landing?	No	No	DWS Offset RT (in)	N/A
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.0
N/A	Painted X Walk1?	No		Road Slope (%)	1.8
	X Walk 1 Direction	To SE		Road X Slope (%)	0.9
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	1.8	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.9	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	6.8

