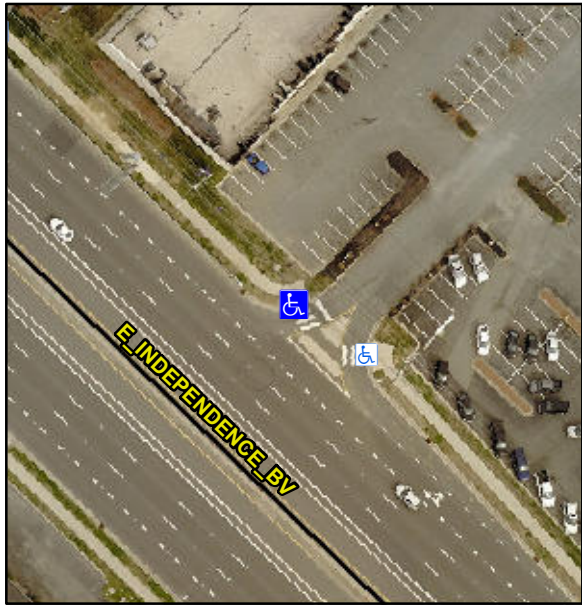


# Access Compliance Report

## Public Rights-of-Way (Curb Ramps)

Intersection ID: N/A	Main Street: INDEPENDENCE_RD	Cross Street: N/A	Location: N
ADA ID: 834522BB66E4	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No Severity Score: 37.5

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance						
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		N/A	Ramp Length (in)	72.0	No	Ramp Slope (%)	11.5
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	9.9
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
PROW/ADA:		N/A	Shared Landing?	N/A				
<b>R304.2.2, R304.5.3</b>		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	Yes	
			X Walk 1 Direction	To SW		X Walk 2 Direction	To SE	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	119.0	
			X Walk 1 Slope (%)	10.2		X Walk 2 Slope (%)	5.8	
			X Walk 1 X Slope (%)	4.5		X Walk 2 X Slope (%)	10.1	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	Yes	
			Road Slope (%)	9.6	N/A	Clear Space?	N/A	
			Road X Slope (%)	8.4	N/A	Clear Space to XWalk (in)	N/A	
Total Cost:		\$	3200.00	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
						Storm Grate/Utility Type		
				N/A			N/A	
					Yes	Surface Condition? (G/P)	Good	

Street 1 Name	E INDEPENDENCE BV
Stop Condition-Street 2	None
Street 2 Name	ENTRANCE
Stop Condition-Street 1	None

