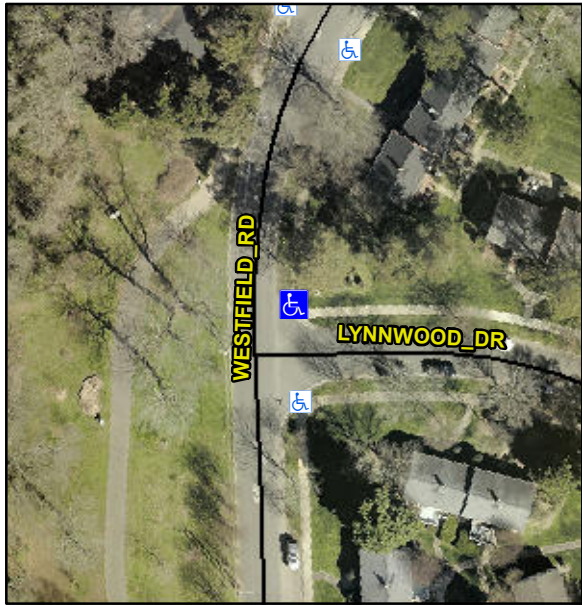


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 17261	Main Street: LYNNWOOD_DR	Cross Street: WESTFIELD_RD	Location: NE
ADA ID: 8349A8E84719	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 17.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.		N/A	Ramp Length (in)	53.0	Yes	Ramp Slope (%)	5.1
			Yes	Ramp Width (in)	80.0	No	Ramp XSlope (%)	3.2
			N/A	Flare Type LT	None	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
			No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
			No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
			No	Landing X Slope (%)	N/A	No	DWS Full Width?	No
			N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	5.5
			N/A	Shared Landing?	N/A			
			Yes	Gutter Ponding?	No	No	Gutter Slope (%)	8.7
			Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.0
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To W		X Walk 2 Direction	To S
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	2.3
				X Walk 1 X Slope (%)	2.7		X Walk 2 X Slope (%)	0.0
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	0.8	N/A	Clear Space?	Yes	
			Road X Slope (%)	3.3	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
					N/A		N/A	
					Yes	Surface Condition? (G/P)	Good	

Street 1 Name	WESTFIELD RD
Stop Condition-Street 2	None
Street 2 Name	LYNNWOOD DR
Stop Condition-Street 1	StopSign

