

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 45513	Main Street: FIRST_BLOOM_RD	Cross Street: HEDGEROW_PARK_RD	Location: NW
ADA ID: 839E47896150	Ramp Type: Combination1Diag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

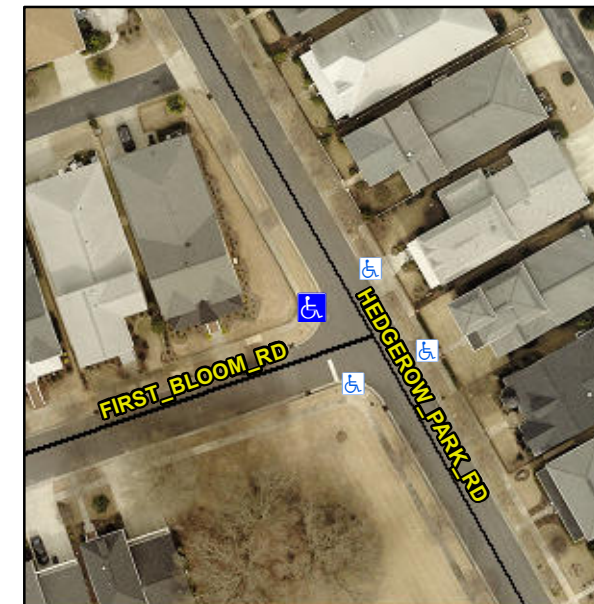

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

LT RP < 5%

PROW/ADA:

Not Found, R304.5.1, R304.5.1, R304.5.3

Total Cost:

\$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	22.0	N/A	Ramp Length RT (in)	32.0
No	Ramp Width LT (in)	47.0	No	Ramp Width RT (in)	47.0
Yes	Ramp Slope LT (%)	2.3	Yes	Ramp Slope RT (%)	7.3
No	Ramp XSlope LT (%)	2.7	Yes	Ramp XSlope RT (%)	1.6
N/A	Ramp Length (in)	73.0	Yes	Ramp Slope (%)	7.9
No	Ramp Width (in)	36.0	No	Ramp XSlope (%)	3.5
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	3.2
	X Walk 1 X Slope (%)	3.8		X Walk 2 X Slope (%)	2.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.0		Clear Space?	N/A
	Road X Slope (%)	4.2	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
					N/A
Yes	Surface Condition? (G/P)	Good			
	Curb Slope (%)	16.6			

Street 1 Name	StopSign
Stop Condition-Street 1	FIRST BLOOM RD
Street 2 Name	None
Stop Condition-Street 2	HEDGEGROW PARK RD

