


Intersection ID: 10116	Main Street: MILL_RD	Cross Street: SOLOMON_ST	Location:	SE
ADA ID: 841B92411A6A	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 13.75

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
 <div>Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1</div>	<div>Possible Solutions:</div> <div>Remove & Replace Entire Ramp.</div>			Compliance	Description	Data	Compliance	Description	Data
				N/A	Ramp Length (in)	38.0	No	Ramp Slope (%)	11.4
				Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.2
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
	<div>Surveyor Notes:</div> <div>N/A</div> <div>PROW/ADA: R304.2.2, R304.5.3</div>			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
				N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
				N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
			N/A	Shared Landing?	N/A				
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A	
				X Walk 1 Direction	To W		X Walk 2 Direction	N/A	
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
				X Walk 1 Slope (%)	3.9		X Walk 2 Slope (%)	N/A	
				X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	N/A	
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
				Road Slope (%)	N/A	N/A	Clear Space?	N/A	
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
				Obstruction Type			Storm Grate/Utility Type		
					N/A			N/A	
						Yes	Surface Condition? (G/P)	Good	

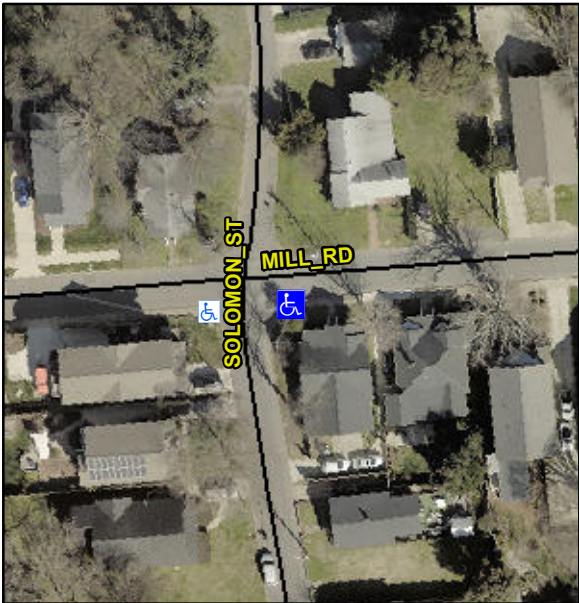