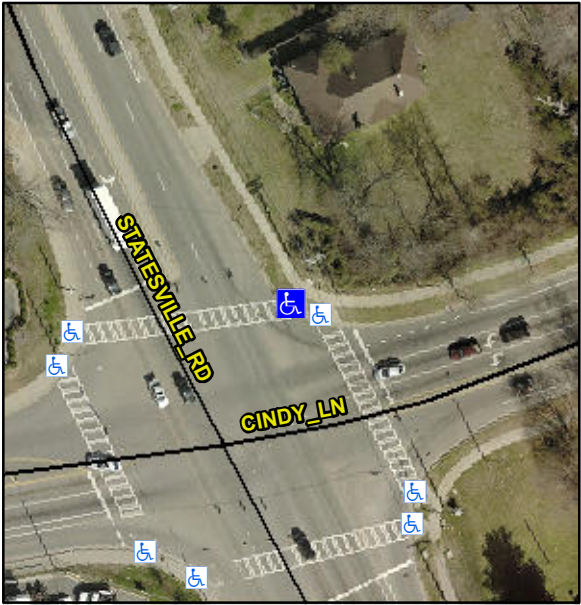


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 6882	Main Street: STATESVILLE_RD	Cross Street: CINDY_LN	Location: NE
ADA ID: 844EF6CD0E11	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 0.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Entire Ramp.</b>		<b>Yes</b>	Ramp Length (in)	108.5
	<b>Remove &amp; Replace Gutter.</b>		<b>No</b>	Ramp Width (in)	48.0
			<b>N/A</b>	Flare Type LT	Sloped
			<b>N/A</b>	Flare Slope LT (%)	10.6
			<b>N/A</b>	Flare Traversable LT?	No
			<b>Yes</b>	Flare Type RT	N/A
			<b>N/A</b>	Flare Slope RT (%)	5.7
			<b>N/A</b>	Flare Traversable RT?	No
			<b>Yes</b>	Landing Length (in)	59.5
Surveyor Notes:  <b>N/A</b>			<b>Yes</b>	DWS Provided?	Yes
			<b>Yes</b>	Landing Width (in)	49.0
			<b>Yes</b>	DWS Contrast?	Yes
			<b>Yes</b>	DWS Length (in)	24.5
			<b>No</b>	DWS Full Width?	Yes
			<b>No</b>	DWS Offset (in)	1.0
			<b>N/A</b>	Landing X Slope (%)	2.6
			<b>N/A</b>	Landing Curb? (Y/N)	No
			<b>N/A</b>	Shared Landing?	No
			<b>No</b>	Gutter Ponding?	Yes
PROW/ADA:  <b>Not Found, R304.5.3, R302.7</b>			<b>Yes</b>	Gutter Slope (%)	4.0
			<b>No</b>	Gutter Lip Ht (in)	0.0
			<b>Yes</b>	Gutter X Slope (%)	2.7
			<b>N/A</b>	Painted X Walk1?	N/A
			<b>Yes</b>	Painted X Walk2?	N/A
			<b>To W</b>	X Walk 1 Direction	N/A
			<b>N/A</b>	X Walk 2 Direction	N/A
			<b>N/A</b>	X Walk 1 Width (in)	N/A
			<b>N/A</b>	X Walk 2 Width (in)	N/A
			<b>N/A</b>	X Walk 1 Slope (%)	N/A
Total Cost:			<b>N/A</b>	X Walk 2 Slope (%)	N/A
			<b>N/A</b>	X Walk 1 X Slope (%)	N/A
			<b>Yes</b>	X Walk 2 X Slope (%)	N/A
			<b>Yes</b>	Ramp inside XWalk1?	N/A
			<b>N/A</b>	Ramp inside XWalk2?	N/A
			<b>N/A</b>	Road Slope (%)	Yes
			<b>N/A</b>	Road X Slope (%)	N/A
			<b>N/A</b>	Clear Space?	N/A
			<b>N/A</b>	Clear Space to XWalk (in)	N/A
			<b>Yes</b>	Any Obstructions?	No
\$ 2600.00			<b>No</b>	Storm Grate/Utility Hazard?	No
				Obstruction Type	
			<b>N/A</b>	Storm Grate/Utility Type	
			<b>N/A</b>		N/A
			<b>Yes</b>	Surface Condition? (G/P)	Good

