


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

| | | |
|---|--|--|
| Intersection ID: 29736 | Main Street: BALLANTYNE CORPORATE PCross Street: HARNEY DR | Location: NW |
| ADA ID: 8471C6E39576 | Ramp Type: BlendTrans2 | Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 15.25 |
| Codes/Mitigation Info/Possible Solution | | Field Measurements/Component Compliance |

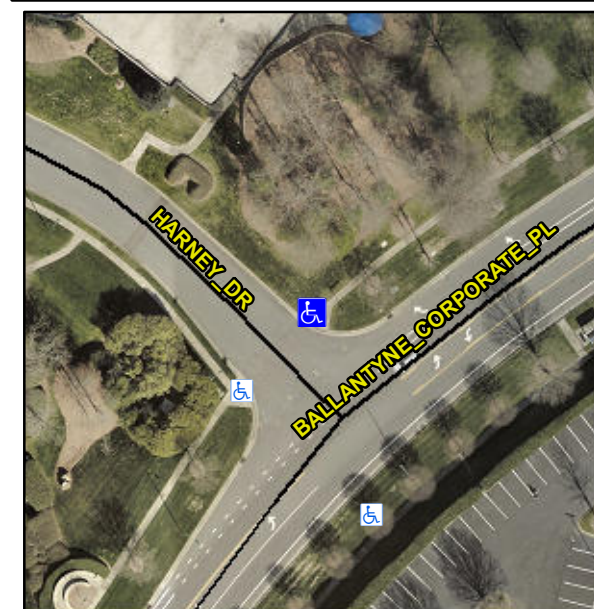

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R305, R304.5.4

Total Cost: \$ 3950.00

| Compliance | Description | Data | Compliance | Description | Data |
|------------|-----------------------|--------|------------|-----------------------------|--------|
| N/A | Ramp Length (in) | 136.0 | Yes | BlendTrans Slope (%) | 4.4 |
| Yes | Ramp Width (in) | 48.0 | No | BlendTrans XSlope (%) | 3.2 |
| N/A | Flare Type LT | Sloped | N/A | Flare Type RT | Sloped |
| N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| N/A | Flare Traversable LT? | No | N/A | Flare Traversable RT? | No |
| N/A | Landing Length (in) | N/A | No | DWS Provided? | No |
| N/A | Landing Width (in) | N/A | N/A | DWS Contrast? | No |
| N/A | Landing Slope (%) | N/A | N/A | DWS Length (in) | N/A |
| N/A | Landing X Slope (%) | N/A | N/A | DWS Full Width? | No |
| N/A | Landing Curb? (Y/N) | No | N/A | DWS Offset (in) | N/A |
| N/A | Shared Landing? | No | | | |
| Yes | Gutter Ponding? | No | No | Gutter Slope (%) | 5.8 |
| Yes | Gutter Lip Ht (in) | 0.0 | Yes | Gutter X Slope (%) | 0.5 |
| N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | No |
| | X Walk 1 Direction | To SW | | X Walk 2 Direction | To SE |
| | X Walk 1 Width (in) | N/A | | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 0.1 | | X Walk 2 Slope (%) | 2.9 |
| | X Walk 1 X Slope (%) | 0.2 | | X Walk 2 X Slope (%) | 0.1 |
| N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | 0.6 | | Clear Space? | Yes |
| | Road X Slope (%) | 2.1 | N/A | Clear Space to XWalk (in) | N/A |
| Yes | Any Obstructions? | No | Yes | Storm Grate/Utility Hazard? | No |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |
| | | | N/A | Curb Slope (%) | 3.0 |

Street 1 Name HARNEY DR
 Stop Condition-Street 1 StopSign
 Street 2 Name BALLANTYNE CORPORATE PL
 Stop Condition-Street 2 None

