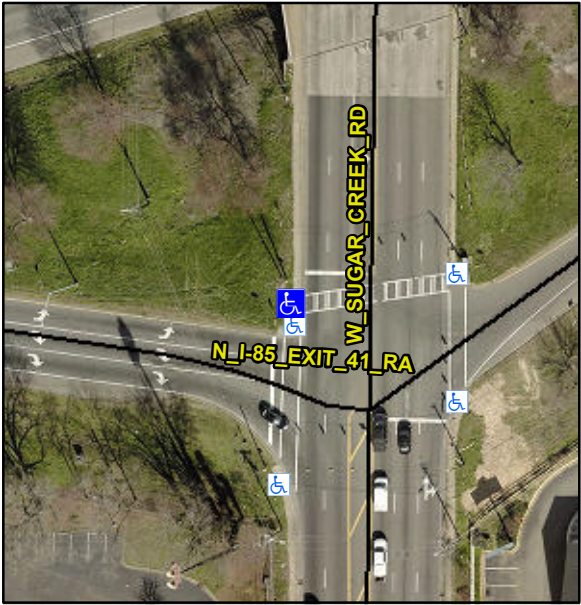


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 7280	Main Street: N_I-85_EXIT_41_RA	Cross Street: W_SUGAR_CREEK_RD	Location: NW
ADA ID: 8476E822EC85	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	70.5
			Yes	Ramp Width LT (in)	58.0
			No	Ramp Slope LT (%)	8.4
			Yes	Ramp XSlope LT (%)	0.4
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.3.2, R304.5.3</p>			N/A	Ramp Slope RT (%)	7.0
			Yes	Ramp XSlope RT (%)	3.1
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Slope (%)	N/A
			N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	Yes
<p>Street 1 Name</p> <p>Stop Condition-Street 1</p> <p>Street 2 Name</p> <p>Stop Condition-Street 2</p>			N/A	X Walk 1 Direction	To E
			N/A	X Walk 1 Width (in)	101.0
				X Walk 1 Slope (%)	4.1
				X Walk 1 X Slope (%)	1.1
			N/A	Ramp inside XWalk1?	Yes
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			N/A	Storm Grate/Utility Hazard?	N/A
<p>Total Cost:</p> <p>\$ 1600.00</p>			N/A	Storm Grate/Utility Type	
				Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	17.5

