

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 53270	Main Street: MONROE_RD	Cross Street: MERIDIAN_CENTER_DR	Location: NE
ADA ID: 84AA31CECF00	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 10	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

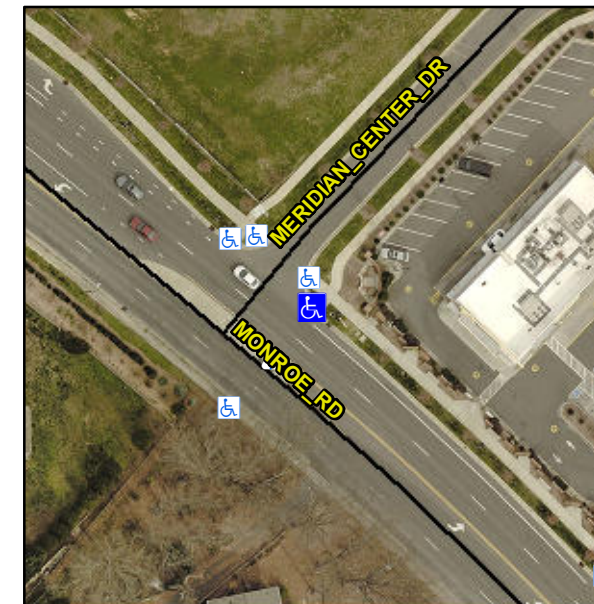

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.2, R305

Total Cost:

\$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	71.0	No	Grade Break?	No
Yes	Ramp Width (in)	69.0	N/A	Grade Break Slope (%)	1.4
Yes	Ramp Slope (%)	5.2	N/A	Grade Break XSlope (%)	1.6
Yes	Ramp XSlope (%)	0.4			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	70.0	No	DWS Provided?	No
Yes	Landing Width (in)	69.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.2	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	0.9	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
N/A	Shared Landing?	Yes	N/A	DWS Offset RT (in)	N/A
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.7
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.0
N/A	Painted X Walk1?	No		Road Slope (%)	2.1
	X Walk 1 Direction	To SW		Road X Slope (%)	1.4
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	2.1	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.4	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	6.0

Street 1 Name	MONROE RD
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

