


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12220	Main Street: E_6TH_ST	Cross Street: N_COLLEGE_ST	Location: W
ADA ID: 84F61ABAA9F8	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 5.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

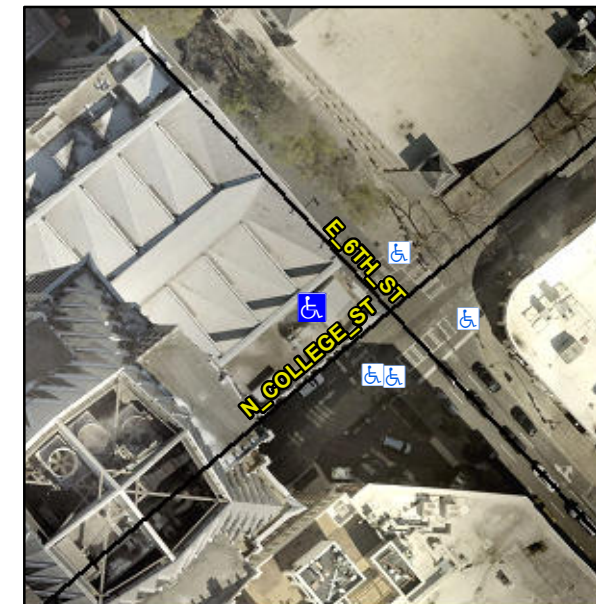

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.2.2-Perp, R304.3.2-Para, R305.2, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	36.0	Yes	BlendTrans Slope (%)	3.5
Yes	Ramp Width (in)	48.0	No	BlendTrans XSlope (%)	4.8
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	3.7	N/A	Flare Slope RT (%)	10.8
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.1	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	4.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.5
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.0
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
	X Walk 1 Width (in)	100.0		X Walk 2 Width (in)	112.0
	X Walk 1 Slope (%)	2.6		X Walk 2 Slope (%)	3.4
	X Walk 1 X Slope (%)	1.7		X Walk 2 X Slope (%)	2.3
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	2.8		Clear Space?	Yes
	Road X Slope (%)	1.5	Yes	Clear Space to XWalk (in)	48.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	24.1

