


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 27363	Main Street: REA_RD	Cross Street: BALLANTYNE_COMMONS_PY	Location: SE
ADA ID: 85718400A38A	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 37.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

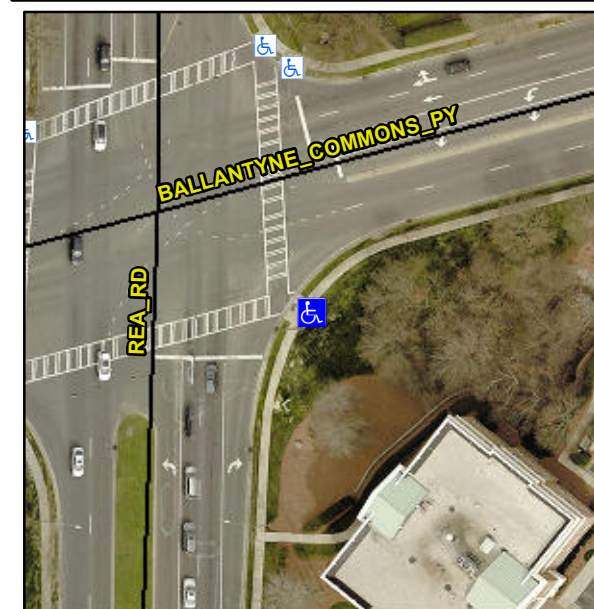

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.3.2, R304.5.3**

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	66.0	N/A	Ramp Length RT (in)	68.0
Yes	Ramp Width LT (in)	107.0	Yes	Ramp Width RT (in)	106.0
No	Ramp Slope LT (%)	8.6	No	Ramp Slope RT (%)	8.4
No	Ramp XSlope LT (%)	7.3	Yes	Ramp XSlope RT (%)	2.0
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
N/A	X Walk 1 Width (in)	120.0	N/A	X Walk 2 Width (in)	119.0
	X Walk 1 Slope (%)	2.1		X Walk 2 Slope (%)	2.5
	X Walk 1 X Slope (%)	1.1		X Walk 2 X Slope (%)	0.6
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	Yes
	Road Slope (%)	0.8	N/A	Clear Space?	N/A
	Road X Slope (%)	3.0	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	10.8

