
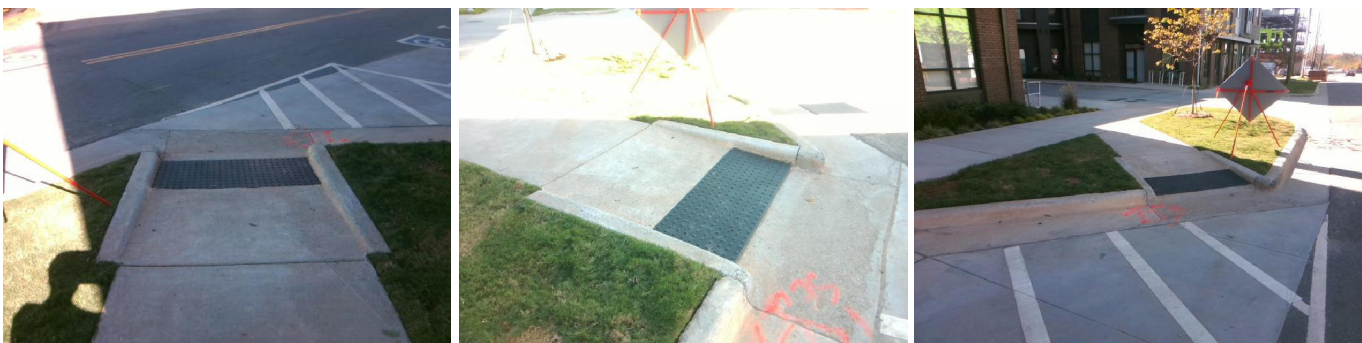


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10040755	Main Street: W_TREMONT_AV	Cross Street: N/A	Location: SW
ADA ID: 85C4BAD09D1D	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 0.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	62.0
	Remove & Replace Gutter.		Yes	Ramp Width (in)	59.0
			Yes	Flare Type L	Curbed_NoWalkSurface
			Yes	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	No
			Yes	Landing Length (in)	60.0
			Yes	Landing Width (in)	60.0
			Yes	Landing Slope (%)	1.9
			Yes	Landing X Slope (%)	1.0
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.3</p>			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	No
			Yes	DWS Provided?	Yes
			Yes	DWS Contrast?	Yes
			Yes	DWS Length (in)	24.0
			Yes	DWS Full Width?	Yes
			N/A	DWS Offset (in)	0.0
			N/A		
			Yes	Gutter Ponding?	No
<p>Total Cost:</p> <p>\$ 2600.00</p>			Yes	Gutter X Slope (%)	1.4
			No	Gutter Lip Ht (in)	2.1
			N/A	Painted X Walk1?	N/A
				X Walk 1 Direction	N/A
			N/A	X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	N/A
			N/A	X Walk 2 Width (in)	N/A
			1.0	X Walk 1 Slope (%)	N/A
			0.8	X Walk 2 Slope (%)	N/A
			N/A	X Walk 1 X Slope (%)	N/A
			N/A	X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A
			N/A	Ramp inside XWalk2?	N/A
			N/A	Road Slope (%)	Yes
			N/A	Road X Slope (%)	N/A
			Yes	Clear Space?	N/A
			No	Clear Space to XWalk (in)	N/A
			Yes	Storm Grate/Utility Hazard?	No
				Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good