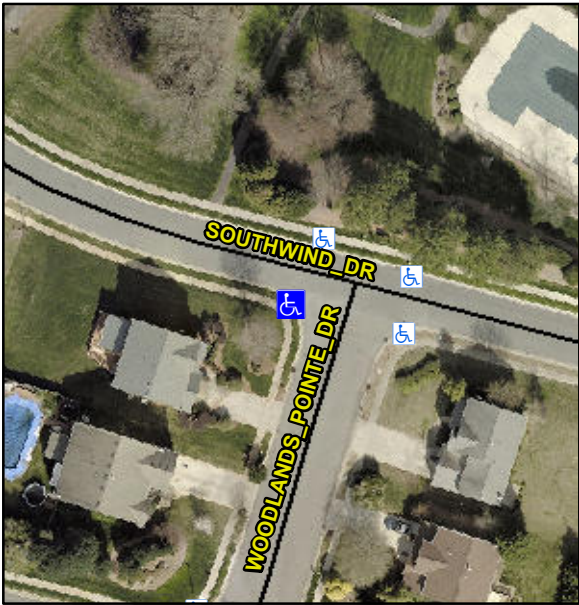


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 30075	Main Street: SOUTHWIND_DR	Cross Street: WOODLANDS_POINTE_DR	Location: W
ADA ID: 85E944A33602	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance																	
	Possible Solutions:		Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.																	
	Surveyor Notes:		N/A																	
	PROW/ADA:		Not Found, R304.5.3, R304.2.1, R305.2																	
	Street 1 Name		WOODLANDS POINTE DR																	
	Stop Condition-Street 2		StopSign																	
	Street 2 Name		SOUTHWIND DR																	
	Stop Condition-Street 1		None																	
	Total Cost:		\$ 3200.00																	
			Compliance			Description			Data			Compliance			Description			Data		
			N/A			Ramp Length (in)			52.0			Yes			Ramp Slope (%)			6.7		
			Yes			Ramp Width (in)			48.0			No			Ramp XSlope (%)			2.2		
			N/A			Flare Type LT			Sloped			N/A			Flare Type RT			N/A		
			N/A			Flare Slope LT (%)			4.7			Yes			Flare Slope RT (%)			2.8		
			N/A			Flare Traversable LT?			Yes			N/A			Flare Traversable RT?			Yes		
			No			Landing Length (in)			41.0			Yes			DWS Provided?			Yes		
			Yes			Landing Width (in)			48.0			Yes			DWS Contrast?			Yes		
			Yes			Landing Slope (%)			1.7			Yes			DWS Length (in)			24.0		
			Yes			Landing X Slope (%)			2.0			Yes			DWS Full Width?			Yes		
			N/A			Landing Curb? (Y/N)			No			No			DWS Offset (in)			3.0		
			N/A			Shared Landing?			No											
			Yes			Gutter Ponding?			No			Yes			Gutter Slope (%)			1.2		
			Yes			Gutter Lip Ht (in)			0.0			Yes			Gutter X Slope (%)			1.1		
			N/A			Painted X Walk1?			No			N/A			Painted X Walk2?			No		
						X Walk 1 Direction			To SE						X Walk 2 Direction			To NE		
			N/A			X Walk 1 Width (in)			N/A			N/A			X Walk 2 Width (in)			N/A		
						X Walk 1 Slope (%)			4.2						X Walk 2 Slope (%)			4.0		
						X Walk 1 X Slope (%)			0.0						X Walk 2 X Slope (%)			1.5		
			N/A			Ramp inside XWalk1?			N/A			N/A			Ramp inside XWalk2?			N/A		
						Road Slope (%)			1.3			N/A			Clear Space?			Yes		
						Road X Slope (%)			3.5			N/A			Clear Space to XWalk (in)			N/A		
			Yes			Any Obstructions?			No			Yes			Storm Grate/Utility Hazard?			No		
						Obstruction Type									Storm Grate/Utility Type					
												N/A						N/A		
												Yes			Surface Condition? (G/P)			Good		

