


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10020730	Main Street: BEATTIES_FORD_RD	Cross Street: N/A	Location: NE
ADA ID: 8614D78F24EB	Ramp Type: Combination1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

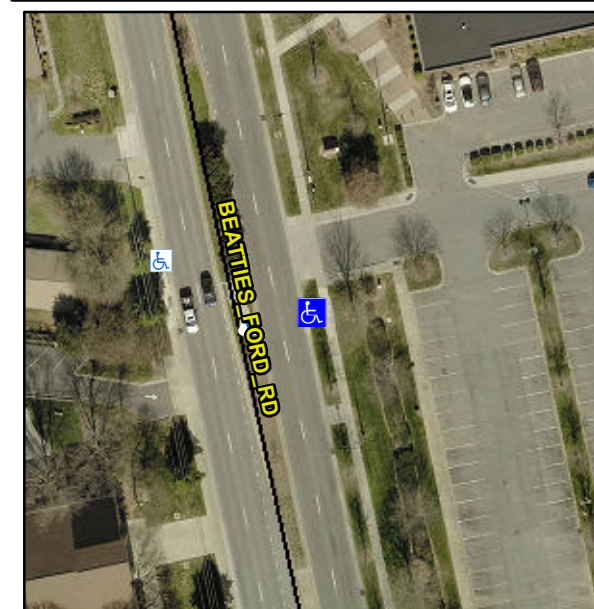

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found**

Total Cost:

**\$ 1800.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	54.0	N/A	Ramp Length RT (in)	54.0
Yes	Ramp Width LT (in)	57.0	Yes	Ramp Width RT (in)	57.0
Yes	Ramp Slope LT (%)	7.1	Yes	Ramp Slope RT (%)	5.3
Yes	Ramp XSlope LT (%)	0.5	Yes	Ramp XSlope RT (%)	0.1
N/A	Ramp Length (in)	91.0	Yes	Ramp Slope (%)	5.0
Yes	Ramp Width (in)	69.0	Yes	Ramp XSlope (%)	0.9
Yes	Flare Type <b>LT</b>	<b>Curbed_NoWalkSurface</b>	Yes	Flare Type <b>RT</b>	<b>Curbed_NoWalkSurface</b>
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	64.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	70.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.9	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	2.0	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	Yes	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.8		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.0		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstruction?	No
				Obstruction Type	N/A
			Yes	Storm Grate/Utility Hazard?	No
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	8.3

