


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 16072	Main Street: MONROE_RD	Cross Street: RICHLAND_DR	Location: SW
ADA ID: 8615E00A3790	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 15.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

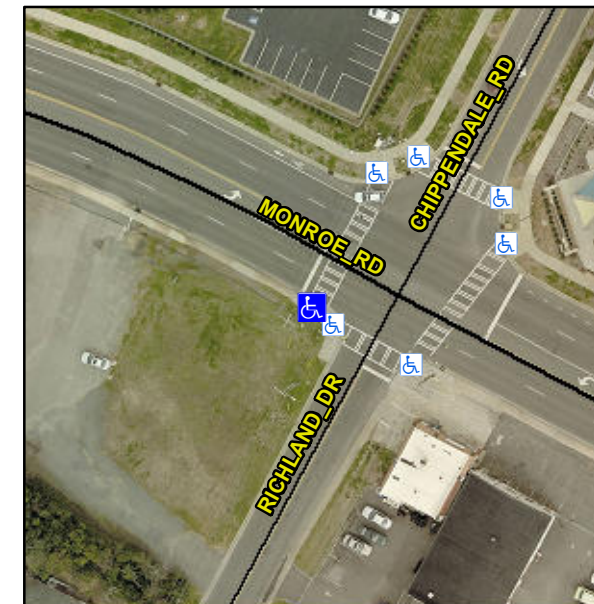

Possible Solutions:

Remove & Replace Entire Ramp.
Remove & Replace Gutter.

Surveyor Notes:

RT RP < 5%

PROW/ADA:

R304.5.3, R304.2.1, R304.2.2-Perp,
R304.3.2-Para, R304.5.4

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	40.0	N/A	Ramp Length RT (in)	58.5
Yes	Ramp Width LT (in)	73.0	Yes	Ramp Width RT (in)	57.5
Yes	Ramp Slope LT (%)	5.3	Yes	Ramp Slope RT (%)	4.6
No	Ramp XSlope LT (%)	2.1	Yes	Ramp XSlope RT (%)	0.7
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	Yes	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	7.8
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.2
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	114.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.6		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.4		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	12.2

