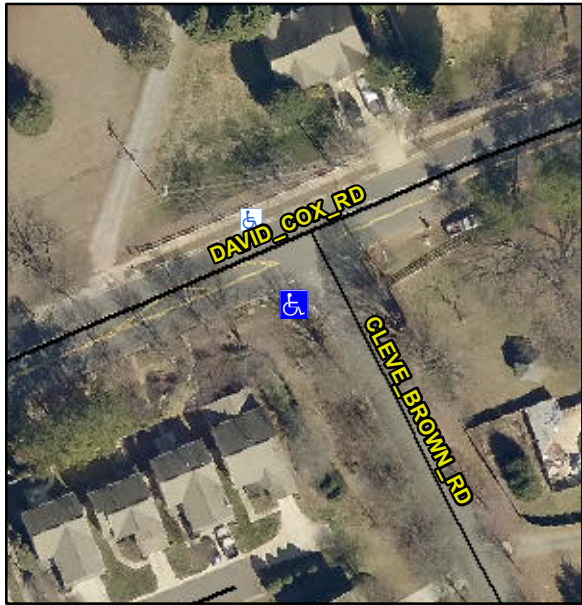


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 4069	Main Street: CLEVE_BROWN_RD	Cross Street: DAVID_COX_RD	Location: SW
ADA ID: 86799128D621	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 5.25	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance						
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.		N/A	Ramp Length (in)	66.0	Yes	Ramp Slope (%)	7.8
			Yes	Ramp Width (in)	55.0	No	Ramp XSlope (%)	2.2
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	1.7	No	Flare Slope RT (%)	10.4
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
	Surveyor Notes:		No	Landing Length (in)	46.5	Yes	DWS Provided?	Yes
			Yes	Landing Width (in)	70.0	Yes	DWS Contrast?	Yes
			Yes	Landing Slope (%)	1.0	Yes	DWS Length (in)	24.0
			No	Landing X Slope (%)	3.4	No	DWS Full Width?	No
N/A			Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0	
PROW/ADA:		N/A	Shared Landing?	No				
		Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.0	
		Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.5	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To N		X Walk 2 Direction	To E	
Street 1 Name DAVID COX RD Stop Condition-Street 2 None Street 2 Name CLEVE BROWN RD Stop Condition-Street 1 StopSign		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	2.9		X Walk 2 Slope (%)	N/A	
			X Walk 1 X Slope (%)	2.9		X Walk 2 X Slope (%)	N/A	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	N/A	N/A	Clear Space?	Yes	
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
		Total Cost: \$ 3950.00				N/A		N/A
							Yes	Surface Condition? (G/P)

