

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 9651	Main Street: CRESTVIEW_DR	Cross Street: FRENCH_ST	Location: SW
ADA ID: 86A0343FAB84	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 2.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

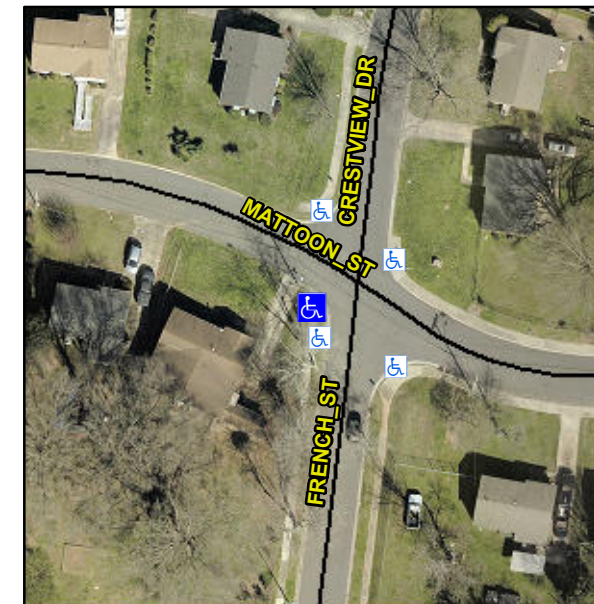

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.2.2-Perp, R304.3.2-
Para, R304.5.3, R304.5.2, R305.1.4,
R305.2**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	56.0	No	Grade Break?	No
Yes	Ramp Width (in)	56.0	N/A	Grade Break Slope (%)	N/A
Yes	Ramp Slope (%)	5.7	N/A	Grade Break XSlope (%)	N/A
Yes	Ramp XSlope (%)	2.3			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	56.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	59.5	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	5.2	Yes	DWS Length (in)	24.5
No	Landing X Slope (%)	2.2	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset LT (in)	36.0
N/A	Shared Landing?	Yes	No	DWS Offset RT (in)	72.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.4
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	6.9
N/A	Painted X Walk1?	No		Road Slope (%)	1.9
	X Walk 1 Direction	To N		Road X Slope (%)	9.7
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	1.9	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	9.7	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	12.9

Total Cost: \$ 2350.00

Street 1 Name	MATTOON ST
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

