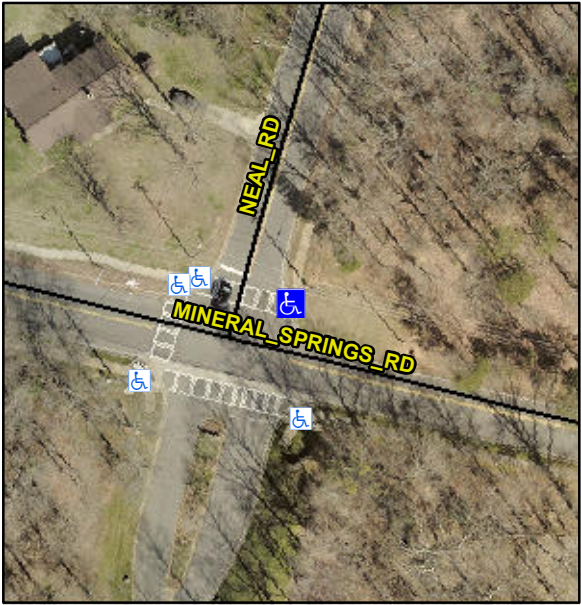


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 6621	Main Street: MINERAL_SPRINGS_RD	Cross Street: NEAL_RD	Location: NE
ADA ID: 876964FE0D8E	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Entire Ramp.</b>		<b>No</b>	Ramp Length (in)	48.0
			<b>No</b>	Ramp Width (in)	43.0
			<b>N/A</b>	Flare Type LT	N/A
			<b>N/A</b>	Flare Slope LT (%)	N/A
			<b>N/A</b>	Flare Traversable LT?	N/A
			<b>N/A</b>	Landing Length (in)	N/A
			<b>N/A</b>	Landing Width (in)	N/A
			<b>N/A</b>	Landing Slope (%)	N/A
			<b>N/A</b>	Landing X Slope (%)	N/A
<p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.5.1, R304.2.2</b></p>			<b>N/A</b>	Flare Type RT	N/A
			<b>N/A</b>	Flare Slope RT (%)	N/A
			<b>N/A</b>	Flare Traversable RT?	N/A
			<b>N/A</b>	DWS Provided?	N/A
			<b>N/A</b>	DWS Contrast?	N/A
			<b>N/A</b>	DWS Length (in)	N/A
			<b>N/A</b>	DWS Full Width?	N/A
			<b>N/A</b>	DWS Offset (in)	N/A
			<b>N/A</b>	Shared Landing?	N/A
			<b>N/A</b>	Gutter Ponding?	N/A
			<b>N/A</b>	Gutter Lip Ht (in)	N/A
			<b>N/A</b>	Painted X Walk1?	Yes
				X Walk 1 Direction	To N
			<b>N/A</b>	X Walk 1 Width (in)	112.0
				X Walk 1 Slope (%)	2.8
				X Walk 1 X Slope (%)	1.8
			<b>N/A</b>	Ramp inside XWalk1?	Yes
			<b>N/A</b>	Road Slope (%)	N/A
			<b>N/A</b>	Road X Slope (%)	N/A
			<b>N/A</b>	Any Obstructions?	N/A
				Obstruction Type	
			<b>N/A</b>		
			<b>N/A</b>		
			<b>N/A</b>		
			<b>N/A</b>		
			<b>N/A</b>		
			<b>N/A</b>		
			<b>N/A</b>		
			<b>N/A</b>		
			<b>N/A</b>		
Total Cost:		\$ 1850.00			
Street 1 Name	NEAL RD				
Stop Condition-Street 2	StopSign				
Street 2 Name	N/A				
Stop Condition-Street 1	N/A				

