


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 29738	Main Street: KING_ARTHUR_DR	Cross Street: MERLIN_MEADOWS_CT	Location: N
ADA ID: 877909631C94	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

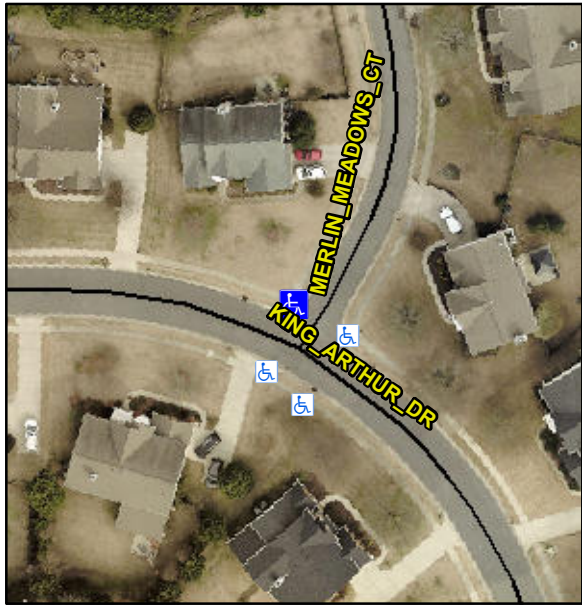

Street 1 Name

KING ARTHUR DR

Stop Condition-Street 2

None

Street 2 Name

MERLIN MEADOWS CT

Stop Condition-Street 1

StopSign

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2, R304.5.3

Total Cost:

\$

3200.00

Compliance		Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	No	Ramp Slope (%)	8.5	
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.3	
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE	
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
	X Walk 1 Slope (%)	0.9		X Walk 2 Slope (%)	0.9	
	X Walk 1 X Slope (%)	2.6		X Walk 2 X Slope (%)	3.1	
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
	Road Slope (%)	3.0	N/A	Clear Space?	N/A	
	Road X Slope (%)	2.3	N/A	Clear Space to XWalk (in)	N/A	
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
	Obstruction Type			Storm Grate/Utility Type		
		N/A			N/A	
			Yes	Surface Condition? (G/P)	Good	

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	No	Ramp Slope (%)	8.5
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.3
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.9		X Walk 2 Slope (%)	0.9
	X Walk 1 X Slope (%)	2.6		X Walk 2 X Slope (%)	3.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.0	N/A	Clear Space?	N/A
	Road X Slope (%)	2.3	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

