


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 4530	Main Street: BROOKSHIRE_BV	Cross Street: MT_HOLLY-HUNTERSVILLE_RD	Location: SW
ADA ID: 877D62347044	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 7.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

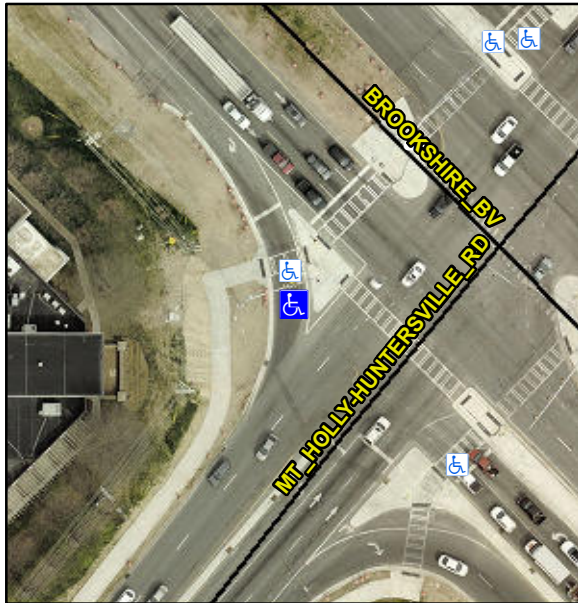

Possible Solutions:

Remove & Replace Detectable Warning System. Grind Gutter Lip.

Surveyor Notes:

N/A

PROW/ADA:

R305.2, R302.7.2

Total Cost: \$ 1000.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	66.0	Yes	BlendTrans Slope (%)	2.4
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	0.7
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	3.3	N/A	Flare Slope RT (%)	6.2
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	57.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.3	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.5	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.6
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	1.7
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	112.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.8		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.8		Clear Space?	Yes
	Road X Slope (%)	2.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
Yes	Surface Condition? (G/P)		Good		
Yes	Curb Slope (%)		3.3		

