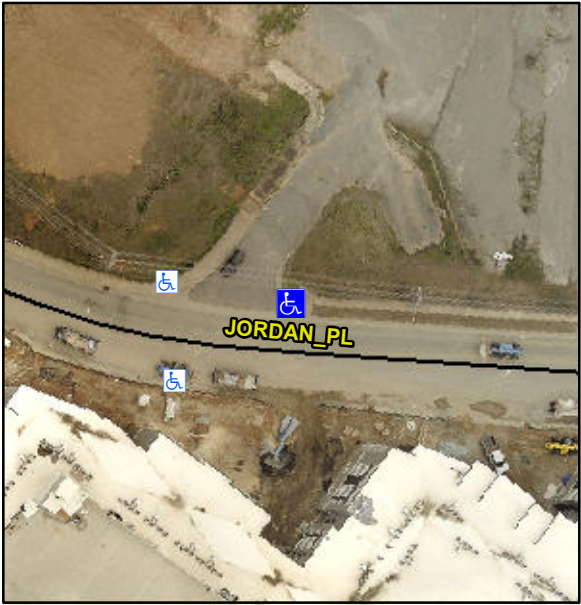


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                        |                        |                         |                        |
|------------------------|------------------------|-------------------------|------------------------|
| Intersection ID: 10577 | Main Street: JORDAN_PL | Cross Street: N/A       | Location: E            |
| ADA ID: 878B7927F5F5   | Ramp Type: Perp        | Initial Pass/Fail: Fail | Overall Compliance: No |
|                        |                        |                         | Severity Score: 36.25  |

| Codes/Mitigation Info/Possible Solution                                          |                               | Field Measurements/Component Compliance |                       |       |            |                             |      |
|----------------------------------------------------------------------------------|-------------------------------|-----------------------------------------|-----------------------|-------|------------|-----------------------------|------|
|  | Possible Solutions:           |                                         |                       |       |            |                             |      |
|                                                                                  | Remove & Replace Entire Ramp. |                                         |                       |       |            |                             |      |
|                                                                                  | Surveyor Notes:               |                                         |                       |       |            |                             |      |
|                                                                                  | N/A                           |                                         |                       |       |            |                             |      |
|                                                                                  | PROW/ADA:                     |                                         |                       |       |            |                             |      |
|                                                                                  | Not Found, R304.5.1           |                                         |                       |       |            |                             |      |
|                                                                                  |                               | Compliance                              | Description           | Data  | Compliance | Description                 | Data |
|                                                                                  |                               | N/A                                     | Ramp Length (in)      | 131.5 | Yes        | Ramp Slope (%)              | 6.2  |
|                                                                                  |                               | No                                      | Ramp Width (in)       | 30.5  | Yes        | Ramp XSlope (%)             | 4.5  |
|                                                                                  |                               | N/A                                     | Flare Type LT         | N/A   | N/A        | Flare Type RT               | N/A  |
|                                                                                  |                               | N/A                                     | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | N/A  |
|                                                                                  |                               | N/A                                     | Flare Traversable LT? | N/A   | N/A        | Flare Traversable RT?       | N/A  |
|                                                                                  |                               | N/A                                     | Landing Length (in)   | N/A   | N/A        | DWS Provided?               | N/A  |
|                                                                                  |                               | N/A                                     | Landing Width (in)    | N/A   | N/A        | DWS Contrast?               | N/A  |
|                                                                                  |                               | N/A                                     | Landing Slope (%)     | N/A   | N/A        | DWS Length (in)             | N/A  |
|                                                                                  |                               | N/A                                     | Landing X Slope (%)   | N/A   | N/A        | DWS Full Width?             | N/A  |
|                                                                                  |                               | N/A                                     | Landing Curb? (Y/N)   | N/A   | N/A        | DWS Offset (in)             | N/A  |
|                                                                                  |                               | N/A                                     | Shared Landing?       | N/A   |            |                             |      |
|                                                                                  |                               | N/A                                     | Gutter Ponding?       | N/A   | N/A        | Gutter Slope (%)            | N/A  |
|                                                                                  |                               | N/A                                     | Gutter Lip Ht (in)    | N/A   | N/A        | Gutter X Slope (%)          | N/A  |
|                                                                                  |                               | N/A                                     | Painted X Walk1?      | No    | N/A        | Painted X Walk2?            | N/A  |
|                                                                                  |                               |                                         | X Walk 1 Direction    | To W  |            | X Walk 2 Direction          | N/A  |
|                                                                                  |                               | N/A                                     | X Walk 1 Width (in)   | N/A   | N/A        | X Walk 2 Width (in)         | N/A  |
|                                                                                  |                               |                                         | X Walk 1 Slope (%)    | 0.9   |            | X Walk 2 Slope (%)          | N/A  |
|                                                                                  |                               |                                         | X Walk 1 X Slope (%)  | 8.0   |            | X Walk 2 X Slope (%)        | N/A  |
|                                                                                  |                               | N/A                                     | Ramp inside XWalk1?   | N/A   | N/A        | Ramp inside XWalk2?         | N/A  |
|                                                                                  |                               |                                         | Road Slope (%)        | N/A   | N/A        | Clear Space?                | N/A  |
|                                                                                  |                               |                                         | Road X Slope (%)      | N/A   | N/A        | Clear Space to XWalk (in)   | N/A  |
|                                                                                  |                               | N/A                                     | Any Obstructions?     | N/A   | N/A        | Storm Grate/Utility Hazard? | N/A  |
|                                                                                  |                               |                                         | Obstruction Type      |       |            | Storm Grate/Utility Type    |      |
|                                                                                  |                               |                                         |                       |       | N/A        |                             | N/A  |
|                                                                                  |                               |                                         |                       |       | Yes        | Surface Condition? (G/P)    | Good |
| Total Cost:                                                                      |                               | \$                                      | 1850.00               |       |            |                             |      |

