

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 52303	Main Street: VIBURNUM_CT	Cross Street: SNOWBELL_CT	Location: NE
ADA ID: 87A39C806940	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 15.25

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

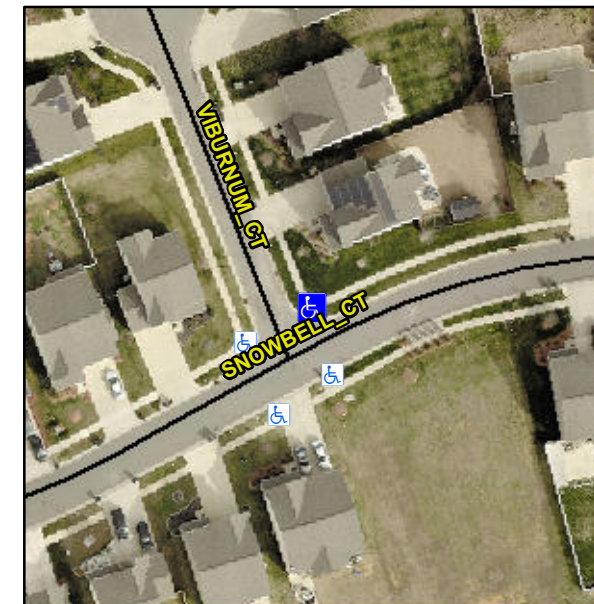

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.3, R304.2.1, R305.2, R302.7, R302.7.2**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	73.0	Yes	Ramp Slope (%)	5.6
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.8
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	4.2	N/A	Flare Slope RT (%)	8.8
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	49.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	42.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.6	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	3.6	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	5.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	4.5
No	Gutter Lip Ht (in)	1.5	No	Gutter X Slope (%)	3.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.0		X Walk 2 Slope (%)	1.3
	X Walk 1 X Slope (%)	1.8		X Walk 2 X Slope (%)	0.9
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.4	N/A	Clear Space?	Yes
	Road X Slope (%)	2.7	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3950.00

