

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 52609	Main Street: SENATOR ROYALL DR	Cross Street: ALEXANDER VILLAGE MAIN DR	Location: SE
ADA ID: 87DEB739DEB6	Ramp Type: BlendTrans1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 1.25	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

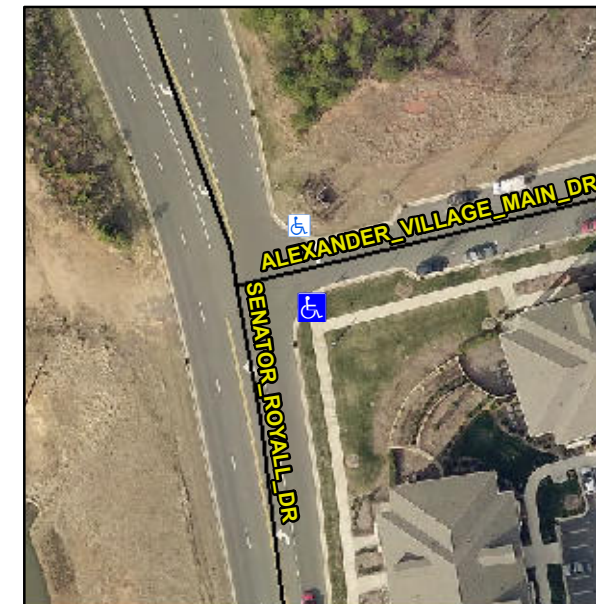

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	122.0	Yes	BlendTrans Slope (%)	4.9
Yes	Ramp Width (in)	62.0	No	BlendTrans XSlope (%)	2.9
N/A	Flare Type L	Curbed_NoWalkSurface	N/A	Flare Type R	Curbed_NoWalkSurface
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
N/A	Landing Length (in)	66.0	N/A	DWS Provided?	Yes
N/A	Landing Width (in)	78.0	N/A	DWS Contrast?	Yes
N/A	Landing Slope (%)	0.5	N/A	DWS Length (in)	24.0
N/A	Landing X Slope (%)	2.3	N/A	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
N/A	Gutter Ponding?	No	N/A	Gutter Slope (%)	1.3
N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	1.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.6		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.6		Clear Space?	Yes
	Road X Slope (%)	0.2	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	No	N/A	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	N/A

Street 1 Name **ALEXANDER VILLAGE MAIN DR**

Stop Condition-Street 1 **StopSign**

Street 2 Name **N/A**

Stop Condition-Street 2 **N/A**

