

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: SHASTA_LN	Cross Street: N/A	Location: W
ADA ID: 87F3E9A31492	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.5	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

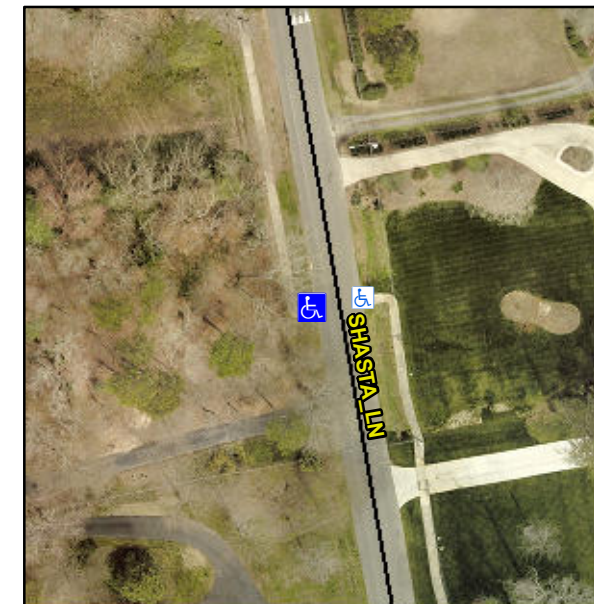

Possible Solutions:

**Remove & Replace Detectable Warning System.**

Surveyor Notes:

**DWS OS MEASURED TO ASP**

PROW/ADA:

**R305.1.4, R305.2**

Total Cost:

\$ 800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	103.5	Yes	BlendTrans Slope (%)	3.0
Yes	Ramp Width (in)	60.0	Yes	BlendTrans XSlope (%)	2.0
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
N/A	Landing X Slope (%)	N/A	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	5.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.0
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.4
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.2		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.2		Clear Space?	Yes
	Road X Slope (%)	5.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	3.5

Street 1 Name	SHASTA LN
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

