


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 16880	Main Street: SELWYN_AV	Cross Street: WESTFIELD_RD	Location: SW
ADA ID: 87FA121AC10D	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 2.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

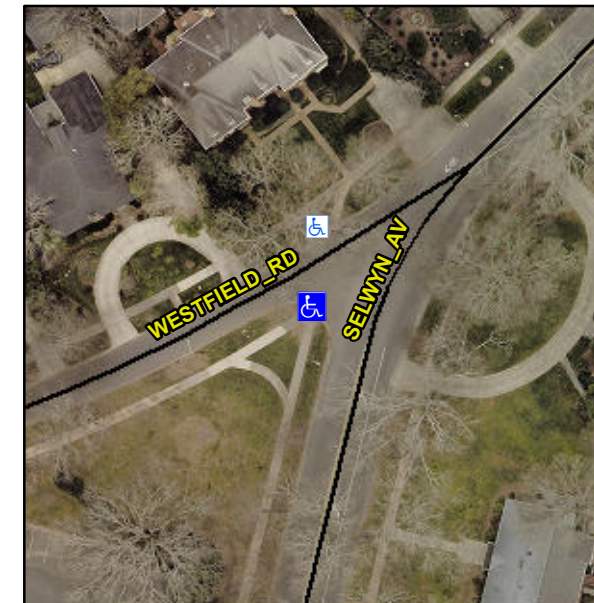

Possible Solutions:

Remove & Replace Detectable Warning System.

Surveyor Notes:

N/A

PROW/ADA:

R305.1.4

Total Cost:

\$ 800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	80.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	59.5	Yes	Grade Break Slope (%)	1.8
Yes	Ramp Slope (%)	7.6	Yes	Grade Break XSlope (%)	0.8
Yes	Ramp XSlope (%)	1.6			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	8.1	Yes	Flare Slope RT (%)	2.2
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.9	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.0	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	0.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	11.5
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.3
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.6
N/A	Painted X Walk1?	No		Road Slope (%)	4.2
	X Walk 1 Direction	To N		Road X Slope (%)	2.5
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	4.2	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.5	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	4.5

