


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 10958 Main Street: CAMP_GREENE_ST Cross Street: TUCKASEEGEE_RD Location: SW

ADA ID: 87FD8975AECC Ramp Type: Perp Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

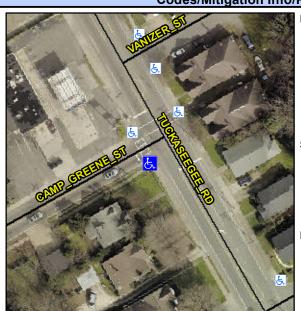

Street 1 Name

CAMP GREENE ST

Stop Condition-Street 2

Signal

Street 2 Name

N/A

Stop Condition-Street 1

N/A

i ossible odlation	
Possible Solutions:	9
Remove & Replace Entire Ramp.	1
	•
	N
	1
	ı
	ı
Surveyor Notes:	ı
N/A	ı
	ı
	ı
	ı
PROW/ADA:	ı
Not Found, R304.2.2, R304.5.3	N
	ı
	ı

Total Cost: \$ 1850.00

Field Measurements/Component Compliance						
Compliance Description		Data	Comp	liance Description	Data	
N/A	Ramp Length (in)	75.0	No	Ramp Slope (%)	8.7	
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.5	
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A	
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A	
N/A	X Walk 1 Width (in)	113.0	N/A	X Walk 2 Width (in)	N/A	
	X Walk 1 Slope (%)	8.3		X Walk 2 Slope (%)	N/A	
	X Walk 1 X Slope (%)	1.8		X Walk 2 X Slope (%)	N/A	
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A	
	Road Slope (%)	N/A	N/A	Clear Space?	N/A	
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
	Obstruction Type			Storm Grate/Utility Type		
		N/A			N/A	
			Yes	Surface Condition? (G/P)	Good	





