


## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 8205Main Street:NORTHAVEN\_DRCross Street:SOFLEY\_RDLocation:SWADA ID: 8848B6781053Ramp Type:PerpInitial Pass/Fail:PassOverall Compliance:NoSeverity Score:0

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

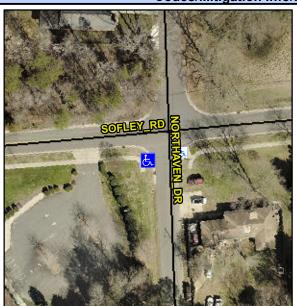

Street 1 Name

Stop Condition-Street 2

StopSign

Street 2 Name

N/A

Stop Condition-Street 1

N/A

Possible Solutions:

Remove & Replace Entire Ramp.

N/
Ye
N/
N/
Surveyor Notes:

Ye
N/A

PROW/ADA:
Ye
Not Found, R304.5.3

Ye
N/

Total Cost: \$ 1850.00

Compliance Description Data		Compliance Description		Data	
N/A	Ramp Length (in)	96.0	Yes	Ramp Slope (%)	7.3
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.8
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	3.9	N/A	Flare Slope RT (%)	9.2
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	58.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.4	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.3
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	То Е		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.7		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.4		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good





