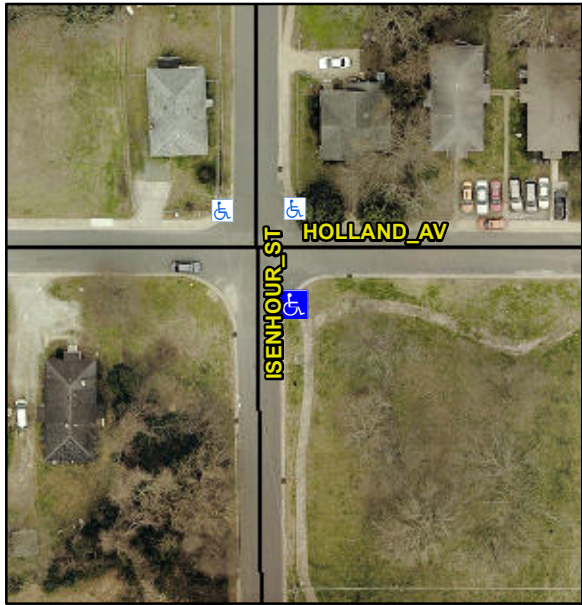


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 8697	Main Street: HOLLAND_AV	Cross Street: ISENHOUR_ST	Location: SE
ADA ID: 885DD6213CA6	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 22.5	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

		Possible Solutions: Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter. Surveyor Notes: LNDG CURVED PROW/ADA: Not Found, R304.2.1, R305, R302.7.2, R304.5.4, R304.5.3		<table><tr><th>Compliance</th><th>Description</th><th>Data</th><th>Compliance</th><th>Description</th><th>Data</th></tr><tr><td>N/A</td><td>Ramp Length (in)</td><td>30.0</td><td>Yes</td><td>BlendTrans Slope (%)</td><td>3.2</td></tr><tr><td>Yes</td><td>Ramp Width (in)</td><td>72.0</td><td>Yes</td><td>BlendTrans XSlope (%)</td><td>1.8</td></tr><tr><td>N/A</td><td>Flare Type LT</td><td>Sloped</td><td>N/A</td><td>Flare Type RT</td><td>Sloped</td></tr><tr><td>N/A</td><td>Flare Slope LT (%)</td><td>2.3</td><td>N/A</td><td>Flare Slope RT (%)</td><td>6.1</td></tr><tr><td>N/A</td><td>Flare Traversable LT?</td><td>No</td><td>N/A</td><td>Flare Traversable RT?</td><td>No</td></tr><tr><td>No</td><td>Landing Length (in)</td><td>46.5</td><td>No</td><td>DWS Provided?</td><td>No</td></tr><tr><td>Yes</td><td>Landing Width (in)</td><td>103.0</td><td>N/A</td><td>DWS Contrast?</td><td>No</td></tr><tr><td>Yes</td><td>Landing Slope (%)</td><td>0.6</td><td>N/A</td><td>DWS Length (in)</td><td>N/A</td></tr><tr><td>Yes</td><td>Landing X Slope (%)</td><td>1.4</td><td>N/A</td><td>DWS Full Width?</td><td>No</td></tr><tr><td>N/A</td><td>Landing Curb? (Y/N)</td><td>No</td><td>N/A</td><td>DWS Offset (in)</td><td>N/A</td></tr><tr><td>N/A</td><td>Shared Landing?</td><td>No</td><td></td><td></td><td></td></tr><tr><td>Yes</td><td>Gutter Ponding?</td><td>No</td><td>No</td><td>Gutter Slope (%)</td><td>6.2</td></tr><tr><td>No</td><td>Gutter Lip Ht (in)</td><td>0.5</td><td>No</td><td>Gutter X Slope (%)</td><td>2.5</td></tr><tr><td>N/A</td><td>Painted X Walk1?</td><td>No</td><td>N/A</td><td>Painted X Walk2?</td><td>No</td></tr><tr><td></td><td>X Walk 1 Direction</td><td>To N</td><td></td><td>X Walk 2 Direction</td><td>To W</td></tr><tr><td></td><td>X Walk 1 Width (in)</td><td>N/A</td><td></td><td>X Walk 2 Width (in)</td><td>N/A</td></tr><tr><td></td><td>X Walk 1 Slope (%)</td><td>1.6</td><td></td><td>X Walk 2 Slope (%)</td><td>N/A</td></tr><tr><td></td><td>X Walk 1 X Slope (%)</td><td>3.8</td><td></td><td>X Walk 2 X Slope (%)</td><td>N/A</td></tr><tr><td>N/A</td><td>Ramp inside XWalk1?</td><td>N/A</td><td>N/A</td><td>Ramp inside XWalk2?</td><td>N/A</td></tr><tr><td></td><td>Road Slope (%)</td><td>N/A</td><td></td><td>Clear Space?</td><td>Yes</td></tr><tr><td></td><td>Road X Slope (%)</td><td>N/A</td><td>N/A</td><td>Clear Space to XWalk (in)</td><td>N/A</td></tr><tr><td>Yes</td><td>Any Obstructions?</td><td>No</td><td>Yes</td><td>Storm Grate/Utility Hazard?</td><td>No</td></tr><tr><td></td><td>Obstruction Type</td><td></td><td></td><td>Storm Grate/Utility Type</td><td></td></tr><tr><td></td><td></td><td></td><td>N/A</td><td></td><td>N/A</td></tr><tr><td></td><td></td><td></td><td>Yes</td><td>Surface Condition? (G/P)</td><td>Good</td></tr><tr><td></td><td></td><td></td><td>No</td><td>Curb Slope (%)</td><td>12.7</td></tr></table>						Compliance	Description	Data	Compliance	Description	Data	N/A	Ramp Length (in)	30.0	Yes	BlendTrans Slope (%)	3.2	Yes	Ramp Width (in)	72.0	Yes	BlendTrans XSlope (%)	1.8	N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped	N/A	Flare Slope LT (%)	2.3	N/A	Flare Slope RT (%)	6.1	N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No	No	Landing Length (in)	46.5	No	DWS Provided?	No	Yes	Landing Width (in)	103.0	N/A	DWS Contrast?	No	Yes	Landing Slope (%)	0.6	N/A	DWS Length (in)	N/A	Yes	Landing X Slope (%)	1.4	N/A	DWS Full Width?	No	N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A	N/A	Shared Landing?	No				Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.2	No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	2.5	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No		X Walk 1 Direction	To N		X Walk 2 Direction	To W		X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A		X Walk 1 Slope (%)	1.6		X Walk 2 Slope (%)	N/A		X Walk 1 X Slope (%)	3.8		X Walk 2 X Slope (%)	N/A	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		Road Slope (%)	N/A		Clear Space?	Yes		Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No		Obstruction Type			Storm Grate/Utility Type					N/A		N/A				Yes	Surface Condition? (G/P)	Good				No	Curb Slope (%)	12.7	<table><tr><td>Street 1 Name</td><td>HOLLAND AV</td></tr><tr><td>Stop Condition-Street 1</td><td>None</td></tr><tr><td>Street 2 Name</td><td>ISENHOUR ST</td></tr><tr><td>Stop Condition-Street 2</td><td>StopSign</td></tr></table>		Street 1 Name	HOLLAND AV	Stop Condition-Street 1	None	Street 2 Name	ISENHOUR ST	Stop Condition-Street 2	StopSign
Compliance	Description	Data	Compliance	Description	Data																																																																																																																																																																																
N/A	Ramp Length (in)	30.0	Yes	BlendTrans Slope (%)	3.2																																																																																																																																																																																
Yes	Ramp Width (in)	72.0	Yes	BlendTrans XSlope (%)	1.8																																																																																																																																																																																
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped																																																																																																																																																																																
N/A	Flare Slope LT (%)	2.3	N/A	Flare Slope RT (%)	6.1																																																																																																																																																																																
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No																																																																																																																																																																																
No	Landing Length (in)	46.5	No	DWS Provided?	No																																																																																																																																																																																
Yes	Landing Width (in)	103.0	N/A	DWS Contrast?	No																																																																																																																																																																																
Yes	Landing Slope (%)	0.6	N/A	DWS Length (in)	N/A																																																																																																																																																																																
Yes	Landing X Slope (%)	1.4	N/A	DWS Full Width?	No																																																																																																																																																																																
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A																																																																																																																																																																																
N/A	Shared Landing?	No																																																																																																																																																																																			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.2																																																																																																																																																																																
No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	2.5																																																																																																																																																																																
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No																																																																																																																																																																																
	X Walk 1 Direction	To N		X Walk 2 Direction	To W																																																																																																																																																																																
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A																																																																																																																																																																																
	X Walk 1 Slope (%)	1.6		X Walk 2 Slope (%)	N/A																																																																																																																																																																																
	X Walk 1 X Slope (%)	3.8		X Walk 2 X Slope (%)	N/A																																																																																																																																																																																
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A																																																																																																																																																																																
	Road Slope (%)	N/A		Clear Space?	Yes																																																																																																																																																																																
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A																																																																																																																																																																																
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No																																																																																																																																																																																
	Obstruction Type			Storm Grate/Utility Type																																																																																																																																																																																	
			N/A		N/A																																																																																																																																																																																
			Yes	Surface Condition? (G/P)	Good																																																																																																																																																																																
			No	Curb Slope (%)	12.7																																																																																																																																																																																
Street 1 Name	HOLLAND AV																																																																																																																																																																																				
Stop Condition-Street 1	None																																																																																																																																																																																				
Street 2 Name	ISENHOUR ST																																																																																																																																																																																				
Stop Condition-Street 2	StopSign																																																																																																																																																																																				
Total Cost:				\$	3950.00																																																																																																																																																																																

