


# Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 29232      Main Street: ROCKWELL\_BV      Cross Street: ROCKWELL\_BV\_WEST      Location: E

ADA ID: 88AC3EB53E99      Ramp Type: Para      Initial Pass/Fail: Fail      Overall Compliance: No      Severity Score: 18.75

### Codes/Mitigation Info/Possible Solution

### Field Measurements/Component Compliance

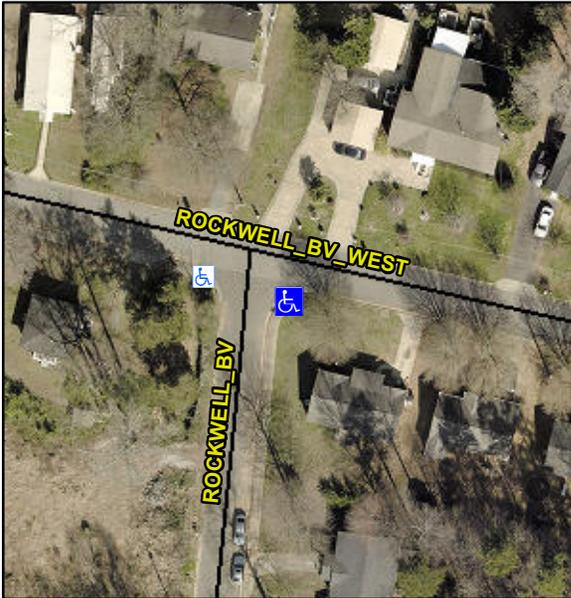

Possible Solutions:  
**Remove & Replace Entire Ramp.**

Surveyor Notes:  
**N/A**

PROW/ADA:  
**R304.5.1, R304.5.3**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	58.0	N/A	Ramp Length RT (in)	47.0
No	Ramp Width LT (in)	35.0	No	Ramp Width RT (in)	35.0
Yes	Ramp Slope LT (%)	8.2	Yes	Ramp Slope RT (%)	5.1
No	Ramp XSlope LT (%)	5.0	No	Ramp XSlope RT (%)	3.7
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	0.5	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.8		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
	Total Cost:	\$ 1600.00	N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	20.5

Street 1 Name                      **ROCKWELL BV**  
 Stop Condition-Street 1              **StopSign**  
 Street 2 Name                      **N/A**  
 Stop Condition-Street 2              **N/A**

