


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 16569	Main Street: FOREST_PARK_DR	Cross Street: PRINCETON_AV	Location: NE
ADA ID: 89335291316F	Ramp Type: ParaDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 15
			Field Measurements/Component Compliance

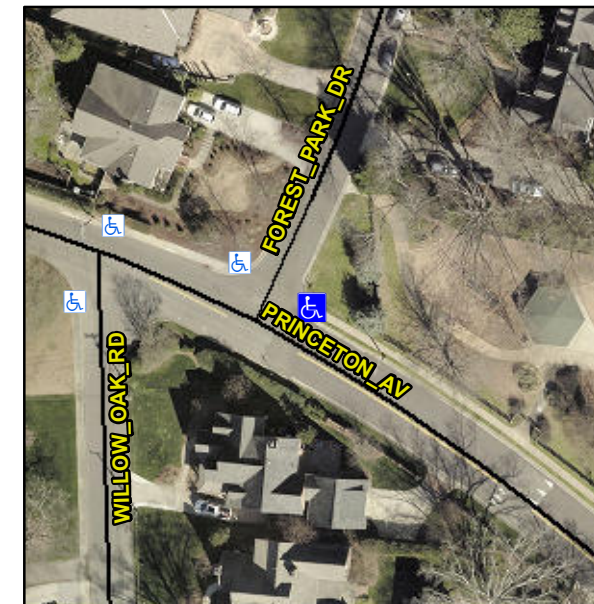

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

RAMP LIP 1.0, LT RP < 5%

PROW/ADA:

R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	48.0	N/A	Ramp Length RT (in)	22.0
Yes	Ramp Width LT (in)	48.0	Yes	Ramp Width RT (in)	54.0
Yes	Ramp Slope LT (%)	1.2	Yes	Ramp Slope RT (%)	6.7
Yes	Ramp XSlope LT (%)	0.3	Yes	Ramp XSlope RT (%)	0.6
Yes	Landing Length (in)	50.0	No	DWS Provided?	No
Yes	Landing Width (in)	52.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	3.6	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	3.3	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	10.5
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.0		X Walk 2 Slope (%)	7.3
	X Walk 1 X Slope (%)	7.8		X Walk 2 X Slope (%)	5.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.6	N/A	Clear Space?	Yes
	Road X Slope (%)	10.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Compliance	Curb Slope (%)	3.0

