


Intersection ID: 13389	Main Street: ELIZABETH_AV	Cross Street: N_KINGS_DR	Location:	E
ADA ID: 8956900890E5	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 5

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp. Remove & Replace Gutter.		N/A	Ramp Length (in)	72.5	Yes	Ramp Slope (%)	7.7
			Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.2
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	7.2	Yes	Flare Slope RT (%)	3.9
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
			No	Landing Length (in)	47.0	Yes	DWS Provided?	Yes
			Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
			No	Landing Slope (%)	3.1	Yes	DWS Length (in)	24.5
			Yes	Landing X Slope (%)	1.7	Yes	DWS Full Width?	Yes
Surveyor Notes: N/A			N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
			N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.8
			Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.2
			N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	76.0	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	3.0		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	0.0		X Walk 2 X Slope (%)	N/A
			Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
PROW/ADA: Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.4				Road Slope (%)	N/A	N/A	Clear Space?	Yes
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
				Obstruction Type			Storm Grate/Utility Type	
						N/A		N/A
						Yes	Surface Condition? (G/P)	Good
Street 1 Name		N KINGS DR						
Stop Condition-Street 2		Signal						
Street 2 Name		N/A						
Stop Condition-Street 1		N/A						
Total Cost:		\$ 2600.00						

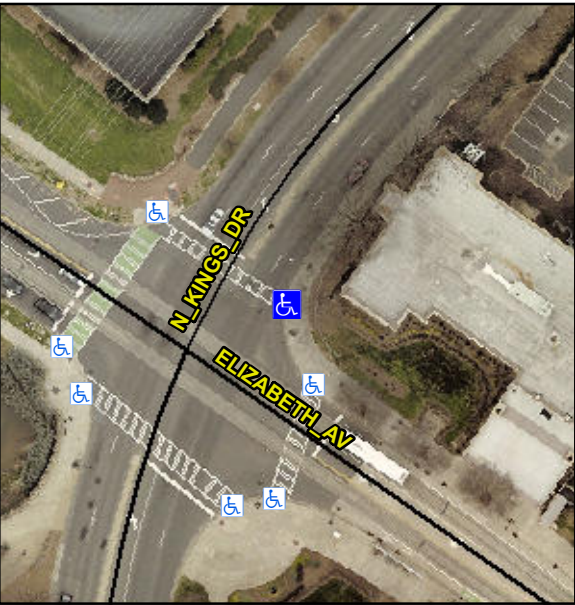