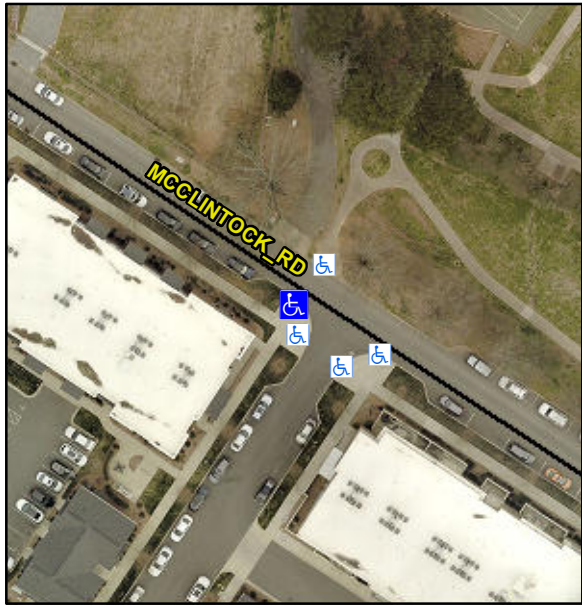


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: MCCLINTOCK_RD	Cross Street: N/A	Location: SW
ADA ID: 896E4B108DFD	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
	Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.			N/A	Ramp Length LT (in)	34.0	N/A	Ramp Length RT (in)	74.0
				Yes	Ramp Width LT (in)	64.0	Yes	Ramp Width RT (in)	61.0
				Yes	Ramp Slope LT (%)	3.2	No	Ramp Slope RT (%)	8.9
				Yes	Ramp XSlope LT (%)	1.4	No	Ramp XSlope RT (%)	2.6
				N/A	Ramp Length (in)	29.0	Yes	Ramp Slope (%)	5.4
				Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	2.0
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Surveyor Notes: LT RP < 5% PROW/ADA: R304.3.2, R304.5.3			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
			N/A	Shared Landing?	N/A	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A	
							X Walk 1 Direction	To NE	
				X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A	
				X Walk 1 Slope (%)	2.5		X Walk 2 Slope (%)	N/A	
				X Walk 1 X Slope (%)	2.3		X Walk 2 X Slope (%)	N/A	
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
				Road Slope (%)	N/A		Clear Space?	N/A	
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
						N/A	Any Obstruction?	N/A	
							Obstruction Type	N/A	
								N/A	
						N/A	Storm Grate/Utility Hazard?	N/A	
							Storm Grate/Utility Type	N/A	
								N/A	
						Yes	Surface Condition? (G/P)	Good	
							Curb Slope (%)	2.1	

Street 1 Name

None

Stop Condition-Street 1

MCCLINTOCK RD

Street 2 Name

N/A

Stop Condition-Street 2

N/A

Total Cost:

\$

1800.00

