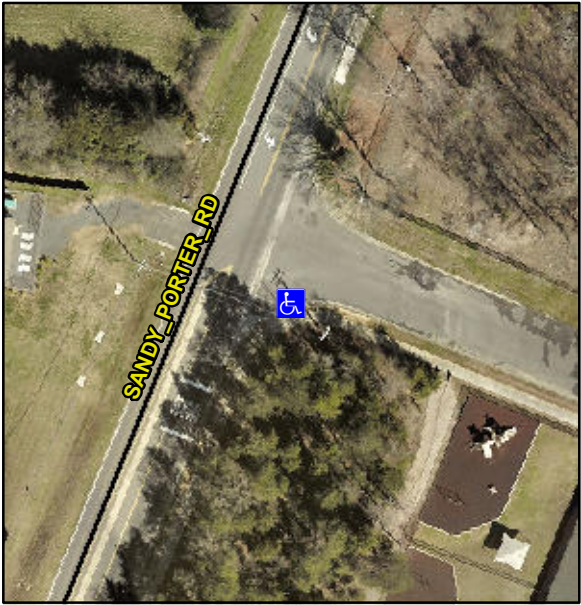


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: SANDY_PORTER_RD	Cross Street: N/A	Location: SE
ADA ID: 89F7FDD1DAA1	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:						
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.	Compliance	Description	Data	Compliance	Description	Data
		N/A	Ramp Length (in)	111.0	Yes	Ramp Slope (%)	6.2
		Yes	Ramp Width (in)	52.0	No	Ramp XSlope (%)	3.2
		N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	2.2	N/A	Flare Slope RT (%)	7.8
		N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
		No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
		No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
		No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
Surveyor Notes: N/A PROW/ADA: Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.1.4, R305.2, R302.7.2		No	Landing X Slope (%)	N/A	No	DWS Full Width?	No
		N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	6.5
		N/A	Shared Landing?	No			
		Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.7
		No	Gutter Lip Ht (in)	1.5	No	Gutter X Slope (%)	2.2
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
			X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	1.6
			X Walk 1 X Slope (%)	2.5		X Walk 2 X Slope (%)	0.5
Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1	ENTRANCE StopSign SANDY PORTER RD None	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	2.0	N/A	Clear Space?	Yes
			Road X Slope (%)	2.7	N/A	Clear Space to XWalk (in)	N/A
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
			Obstruction Type			Storm Grate/Utility Type	
					N/A		N/A
					Yes	Surface Condition? (G/P)	Good
Total Cost:		\$	3950.00				

