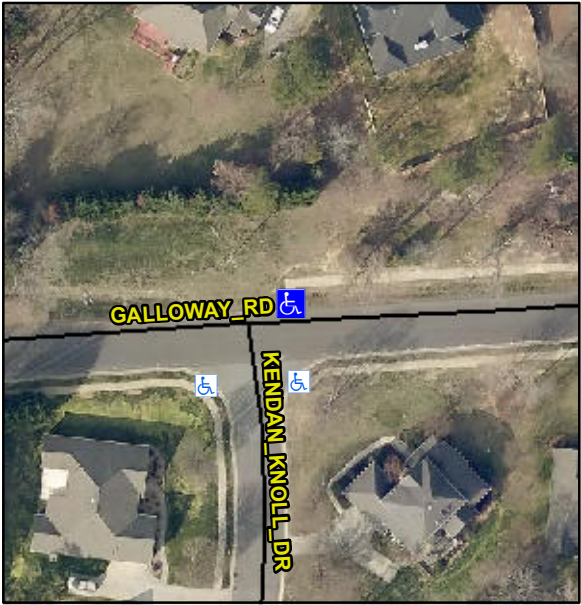


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 4017	Main Street: GALLOWAY_RD	Cross Street: KENDAN_KNOLL_DR	Location: NE
ADA ID: 8A18E2B306C8	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 2.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:							
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Gutter Ponding Observed.							
	Surveyor Notes:		Compliance	Description	Data	Compliance	Description	Data
	N/A		N/A	Ramp Length (in)	126.0	Yes	BlendTrans Slope (%)	2.0
	PROW/ADA:		Yes	Ramp Width (in)	59.5	No	BlendTrans XSlope (%)	2.3
	R304.5.3, R304.2.2-Perp, R304.3.2-Para, R305.1.4, R305.2, R302.7		N/A	Flare Type LT	None	N/A	Flare Type RT	None
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
			Yes	Landing Width (in)	59.0	Yes	DWS Contrast?	Yes
			No	Landing Slope (%)	3.9	Yes	DWS Length (in)	24.5
			No	Landing X Slope (%)	5.5	No	DWS Full Width?	No
			N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	6.0
			N/A	Shared Landing?	Yes			
			No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	0.5
			Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.7
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To S		X Walk 2 Direction	N/A
				X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	1.5		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	1.8		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	1.8		Clear Space?	Yes
				Road X Slope (%)	1.5	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
				Obstruction Type			Storm Grate/Utility Type	
						N/A		N/A
						Yes	Surface Condition? (G/P)	Good
						N/A	Curb Slope (%)	N/A

Total Cost: \$ 3700.00

