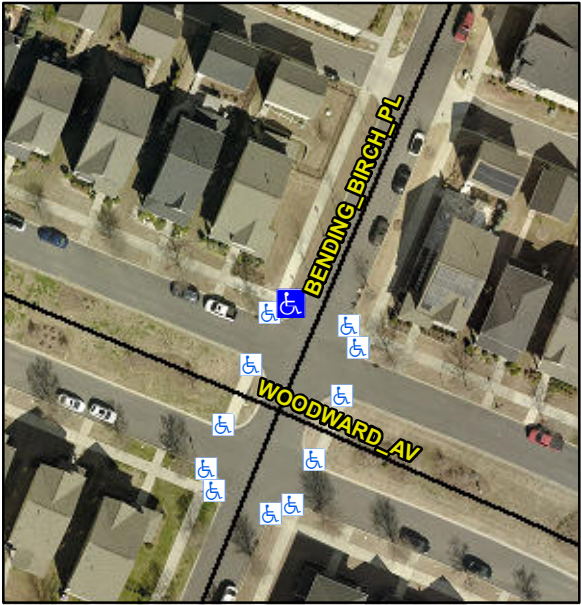


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 52442	Main Street: WOODWARD_AV	Cross Street: BENDING_BIRCH_PL	Location: NW
ADA ID: 8A59A01E0C68	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	76.5	N/A
			Yes	Ramp Width (in)	59.0	N/A
			No	Ramp Slope (%)	9.3	N/A
			No	Ramp XSlope (%)	4.1	N/A
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Flare Type RT	N/A	N/A
			N/A	Flare Slope RT (%)	N/A	N/A
Surveyor Notes: N/A			N/A	Flare Traversable RT?	N/A	N/A
			N/A	Landing Length (in)	0.0	N/A
			N/A	Landing Width (in)	0.0	N/A
			N/A	Landing Slope (%)	0.0	N/A
			N/A	Landing X Slope (%)	0.0	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A
			N/A	Shared Landing?	N/A	N/A
			N/A	Gutter Ponding?	0.0	N/A
			N/A	Gutter Lip Ht (in)	2.0	N/A
			N/A	Painted X Walk1?	No	N/A
PROW/ADA: R304.2.2, R304.5.3				X Walk 1 Direction	To E	N/A
				X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	3.2	N/A
				X Walk 1 X Slope (%)	4.5	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A
			N/A	Any Obstructions?	N/A	N/A
				Obstruction Type		N/A
			Yes	Surface Condition? (G/P)	Good	Good
			N/A	Curb Slope (%)	3.7	N/A
Total Cost:		\$ 1600.00				

Street 1 Name	BENDING BIRCH PL
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

