


Intersection ID: 14668	Main Street: BARRINGER_DR	Cross Street: MANCHESTER_DR	Location:	NW
ADA ID: 8A7445322D55	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 13.75

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

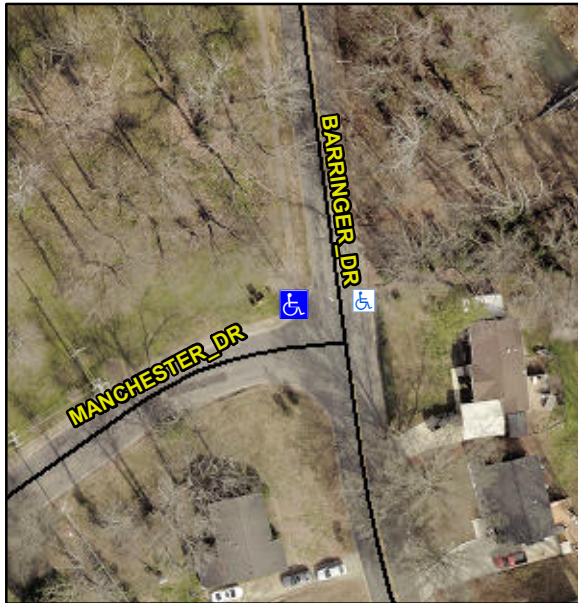

### Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

## NO RT RAMP

PROW/ADA:

**R304.3.2, R304.5.3**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	35.0	N/A	Ramp Length RT (in)	N/A
Yes	Ramp Width LT (in)	48.0	N/A	Ramp Width RT (in)	N/A
No	Ramp Slope LT (%)	9.9	N/A	Ramp Slope RT (%)	N/A
No	Ramp XSlope LT (%)	2.3	N/A	Ramp XSlope RT (%)	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To S		X Walk 2 Direction	To W
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	9.8		X Walk 2 Slope (%)	2.2
	X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	9.4
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.9	N/A	Clear Space?	N/A
	Road X Slope (%)	9.9	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	3.7

**Total Cost: \$ 3200.00**

