


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 42366	Main Street: CARDINALS_NEST_DR	Cross Street: HERON_GLEN_DR	Location:	N
ADA ID: 8AA21883FA4A	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 25
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

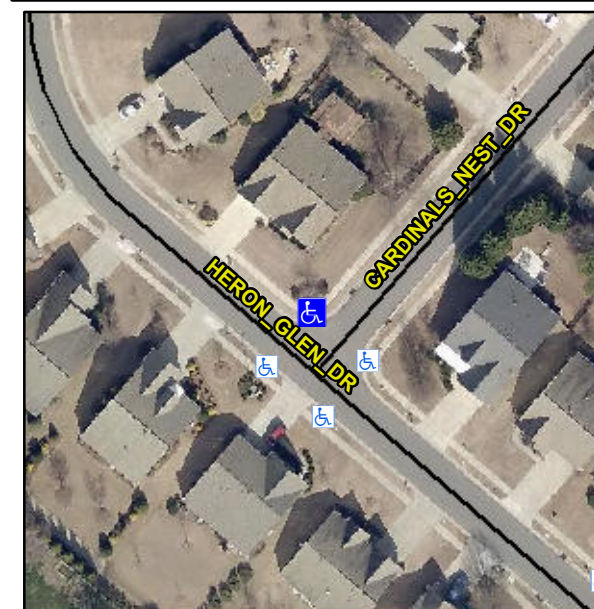

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2-Perp, R304.3.2-Para, R305, R302.7.2

Total Cost: \$ 3400.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	46.0	Yes	Ramp Slope (%)	6.3
Yes	Ramp Width (in)	55.0	Yes	Ramp XSlope (%)	0.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	7.3	N/A	Flare Slope RT (%)	5.2
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	49.0	No	DWS Provided?	No
Yes	Landing Width (in)	72.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	4.9	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	1.8	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.1
No	Gutter Lip Ht (in)	1.5	Yes	Gutter X Slope (%)	0.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.4		X Walk 2 Slope (%)	2.2
	X Walk 1 X Slope (%)	2.7		X Walk 2 X Slope (%)	2.7
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.7	N/A	Clear Space?	Yes
	Road X Slope (%)	1.6	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name **HERO GLEN DR**
 Stop Condition-Street 2 **None**
 Street 2 Name **CARDINALS NEST DR**
 Stop Condition-Street 1 **StopSign**

