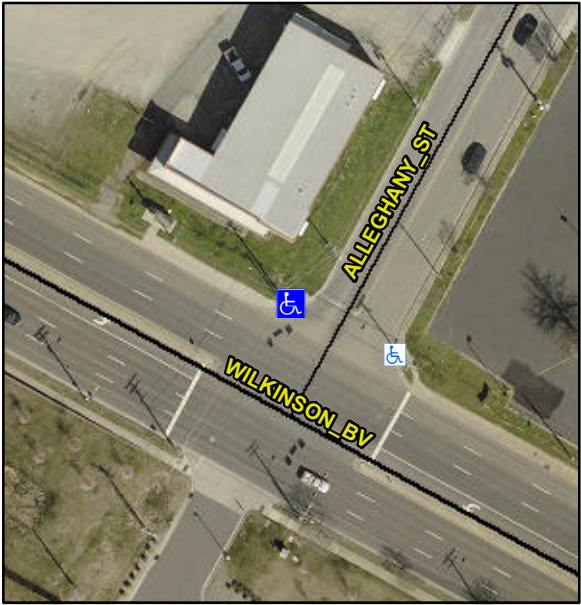


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12144	Main Street: ALLEGHANY_ST	Cross Street: WILKINSON_BV	Location: N
ADA ID: 8ACF206BF2F7	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	28.5
			No	Ramp Width LT (in)	46.0
			No	Ramp Slope LT (%)	11.4
			Yes	Ramp XSlope LT (%)	1.6
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
<p>Surveyor Notes:</p> <p>RT RP <5%</p> <p>PROW/ADA:</p> <p>R304.5.1, R304.3.2</p>			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To SE
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	1.8
				X Walk 1 X Slope (%)	3.4
			N/A	Ramp inside XWalk1?	N/A
				Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	12.1
Total Cost:		\$ 1600.00			

